

SUMMARY 1234 Main St. Tonawanda NY 14150 **Buver Name** 09/05/2018 9:00AM

Christopher Park New York State Licensed Home Inspector, Certified Professional Inspector, RadaLink certified Radon Test Inspector, New York State Licensed Journeyman Plumber, Owens Corning Roof Data Technician Course, Certified Renovator Inspector Course, Advanced Electrical Inspection Training Course, Advanced Radon Measurement Service Provider Course. Guardsman Home Inspection 7164301363

cfpark77@gmail.com

Recommended repair

Summary of items inspected.

2.1.1 Walkways, Patios & Driveways **PATIO CRACKING - MINOR**

Normal settling & cracking observed. Recommend monitor and/or patch/seal. Recommendation Contact a qualified concrete contractor.

2.2.1 Decks, Balconies, Porches & Steps **DECK - LOOSE BOARDS**

Potential Safety Hazard

One or more deck boards were observed to be loose. Recommend they be refastened.

Here is a helpful article for minor DIY deck repair.

Recommendation Contact a qualified deck contractor.




2.2.2 Decks, Balconies, Porches & Steps IMPROPER DECK CONSTRUCTION PRACTICES

Deck was observed to have general poor construction. Recommend gualified deck contractor evaluate. These construction practices may have been normal at time of original construction, but do not meet current safety standards.

Recommendation Contact a qualified deck contractor.



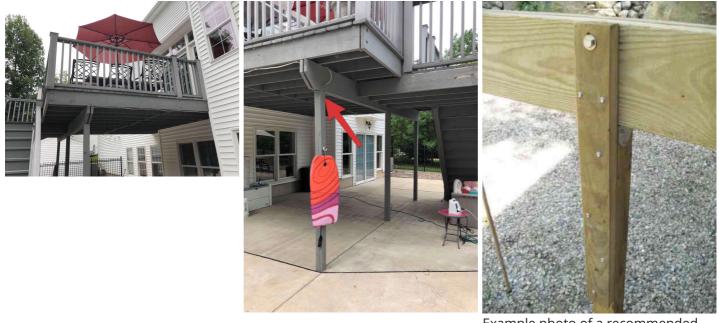

Example photo of a recommended repair for the improper post to beam connections

2.2.3 Decks, Balconies, Porches & Steps **IMPROPER HANDRAIL**



Steps to deck handrail does not meet current safety standards recommend licensed contractor to repair to current standards to prevent possible injury

Recommendation <u>Contact a qualified deck contractor</u>.





3.1.1 Siding, Flashing & Trim **SIDING FLASHING & TRIM STATUS**



Siding, flashing and trim were observed to be fair condition at time of inspection. Normal maintenance may be necessary to prevent damage from occurring.

Recommendation Recommend monitoring.





3.2.1 Exterior Windows **FAILED SEAL**

Observed condensation between the window panes, which indicates a failed thermo pane seal. Recommend qualified window contractor evaluate & replace.

Recommendation Contact a qualified window repair/installation contractor.



Northwest

3.7.1 Exterior foundation TYPICAL CRACKING



Exterior foundation contains typical cracks due to shrinkage and normal freeze thaw cycle. Recommend patching as needed to prevent moisture intrusion.

Recommendation Contact a foundation contractor.



5.6.1 Garage Overhead Door LOUD NOISES



Loud grinding or squaling observed when opening/closing garage door. This can be due to dirt or debris in the track or lack of lubrication. Recommend cleaning the track and lubricating.


Here are some troubleshooting tips before calling a garage contractor.

Recommendation Contact a qualified garage door contractor.

5.8.1 Manual door MAN DOOR RUST

Garage man door has rust and appears to be corroding from inside out. Recommend replacement.

Recommendation Contact a qualified door repair/installation contractor.

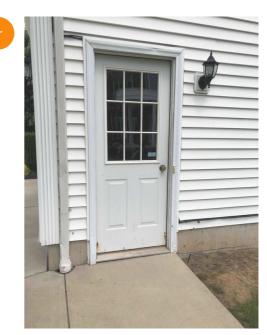

6.4.1 Walls and Ceilings **MOISTURE DAMAGE**



Stains on the walls visible at the time of the inspection appeared to be the result of moisture intrusion. The source of moisture may have been corrected. Recommend further examination by a qualified contractor to provide confirmation.

Recommendation Contact a qualified professional.



Kitchen ceiling near door to deck has been repainted evidence of a prior water damage incident repair appears proper no further repair required at this time

7.4.1 Walls and Ceilings **NAIL POPS**

"Nail-pops" are evident in some areas of drywall where ceilings meet walls. This is common as a home ages due to expansion and contraction of building materials. Recommend repair as needed by licensed contractor.

Additional information on nail popping:

Nail Popping Info

Recommendation Contact a qualified drywall contractor.





Living Room Northwest

9.4.1 Walls and Ceilings MINOR CORNER CRACKS

Minor cracks at the corners of doors and windows in walls. Appeared to be the result of cabinets installed on this wall. Recommend monitoring for change, consult with a licensed contractor if cracks progress further

Recommendation Contact a qualified professional.





9.7.1 Smoke and CO Detectors SMOKE/CO DETECTORS ARE NOT INSTALLED PER CURRENT SAFETY STANDARDS



Smoke Detectors are required to be installed in the following locations per current safety standards:

- I Per Bedroom
- 1 Per level of home
- Must be sealed Battery type (1JAN2017)

CO Detectors are required to be installed in the following locations per current safety standards:

- 1 Within 15' of sleeping areas
- 1 Per level of home
- Must be sealed Battery type (1]AN2017)

Recommendation Contact a qualified professional.

11.4.1 Walls and Ceilings **TYPICAL CRACKS OBSERVED**



Typical cracks in drywall/plaster were observed. These cracks may develop due to normal aging of a home, minor settling, as well as moisture/temperature changes. Recommend repair as needed. No evidence of structural defect observed at time of inspection.

Recommendation Contact a qualified drywall contractor.


11.4.2 Walls and Ceilings

CAULKING/GROUTING IN SHOWER/TUB AREA

Tiles installed in Tub/Shower area have gaps or missing Grout/Caulk. Recommend licensed contractor to repair/replace as needed to prevent moisture damage.

Recommendation Contact a qualified tile contractor



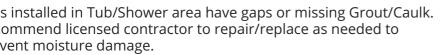



11.4.3 Walls and Ceilings

NAIL POPS

Protruding nail heads visible at the time of the inspection appeared to be the result of contact with moisture. After the source of moisture is located and corrected, protruding nails should be removed, drywall re-fastened and the drywall finished to match the existing wall surfaces. All work should be performed by a qualified drywall or painting contractor.

Recommendation Contact a qualified drywall contractor.





11.4.4 Walls and Ceilings STAIN(S) ON CEILING



ABOVE JACUZZI BATHTUB

There is a stain on ceiling/wall that requires repair and paint. Source of staining should be determined.

Recommendation Contact a qualified professional.

13.5.1 Electrical Components DEFECTIVE 3-WAY SWITCHING

Recommended repair

Bathroom light three-way switch does not appear to be operating properly recommend licensed electrician to further evaluate and repair for proper operation.

Recommendation Contact a qualified electrical contractor.



14.3.1 Walls and Ceilings

POSSIBLE MOLD

There are possible signs of fungi growth. It is unknown if this is a safety hazard. Recommend a qualified mold inspector evaluate.

Recommendation Contact a qualified mold inspection professional.



Basement bathroom dark staining behind toilet appears as a possible mold like substance recommend further evaluation by a licensed environmental contractor

14.5.1 Electrical Components **GFCI FAILED TO TRIP**

Potential Safety Hazard

Bathroom GFCI receptacle failed to trip when tested, recommend licensed electrician to evaluate and repair as needed to prevent possible injuries.

Recommendation Contact a qualified electrical contractor.



15.1.1 Walls and Ceilings TYPICAL CRACKS OBSERVED

Typical cracks in drywall/plaster were observed. These cracks may develop due to normal aging of a home, minor settling, as well as moisture/temperature changes. Recommend repair as needed. No evidence of structural defect observed at time of inspection.

Recommendation Contact a qualified drywall contractor.

15.1.2 Walls and Ceilings

GHOSTING

Parallel consistent ghost like staining observed on surface of drywall this is typical evidence of improper installation or movement of air recommend licensed contractor to further evaluate

Recommendation Contact a qualified professional.

Recommended repair
Reconniciacarepair



Recommended repair

24.1.1 Heating Equipment **FURNACE AGE**

Furnace was operating properly at time of inspection. Average life expectancy is 20 years. This furnace is advanced in age and maybe subject to component failure recommend licensed HVAC technician to clean and service to prolong life expectancy, while budgeting for replacement.

wie 20 waare. This furnas

24.4.1 Distribution Systems **DUCT CLEANING**



Recommend qualified professional to clean heating ducts to prevent buildup of dirt and debris in duct work.