

Buyer Name 05/06/2019 9:00AM





2.4.1 Skylights, Chimneys & Other Roof Penetrations

MINOR DAMAGE

Minor damage to one or more vents was observed. Possible hail damage. Recommend monitoring.

Recommendation Contact a qualified professional.





3.1.2 Siding, Flashing & Trim **GROUND CLEARANCE**

Inadequate clearance between siding and ground. Recommend a minimum ground clearance between bottom of siding and ground of 4". Siding in contact with the ground or soil can lead to deterioration of the siding material caused by moisture and/or wood destroying organisms.

Recommendation Contact a qualified siding specialist.



3.1.3 Siding, Flashing & Trim LOOSE SIDING BRACKETS

Recommendation

One or more siding brackets are loose. This could lead to moisture intrusion and further deterioration of the siding material. Recommend repair or replacement of the brackets.

Recommendation

Contact a qualified siding specialist.



3.4.1 Decks, Balconies, Porches & Steps **JOIST HANGERS**

Multiple nails are missing on Joist hanger(s). Recommend further review by a qualified deck contractor.

Recommendation Contact a qualified deck contractor.





3.4.2 Decks, Balconies, Porches & Steps LEDGER BOARD IMPROPERLY INSTALLED

Insufficiently sized ledger screws. The ledger screws should be 1/2 inch diameter. Recommend further review by a qualified deck contractor. ONE EXCEPTION, "Simpson Strong-Tie Strong-Drive Sds Ledger Deck Screws" are acceptable at 1/4 inch diameter.

Recommendation Contact a qualified deck contractor.



3.4.3 Decks, Balconies, Porches & Steps **RAILING UNSAFE**

There is an unsafe opening in the railing. The spacing on the rail should not exceed 4". An opening greater than 4" is a serious safety hazard especially for children as their head or other body part can become trapped.

Recommendation Contact a qualified deck contractor.




3.4.4 Decks, Balconies, Porches & Steps **NO RAILING**



No safety railing on concrete steps. Recommend adding.

Recommendation Contact a qualified professional.



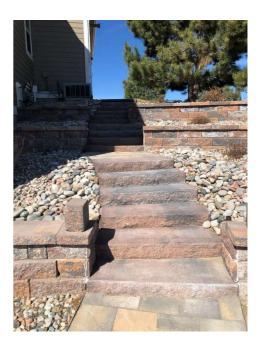

3.4.5 Decks, Balconies, Porches & Steps INSUFFICIENT BRACING

Decks greater than 6 feet above grade should have diagonal bracing across the bottoms of the joists to keep the deck square. A deck that is not held square could permit the outer posts to lean to the right or left, parallel to the ledger board, and thus twist the ledger away from the home or building. Recommend further review by a qualified deck contractor.

Recommendation Contact a qualified deck contractor.





3.5.1 Eaves, Soffits & Fascia **WASPS NEST**

Wasp nests were visible under the soffits. Recommend a qualified exterminator evaluate and remove.

Recommendation Contact a qualified pest control specialist.






6.1.1 Cooling Equipment BEYOND EXPECTED SERVICE LIFE

Recommendation

The exterior condenser/compressor unit is beyond its expected service life. Recommend further review by a qualified heating and cooling contractor. The national average service life for exterior condenser/compressor units is 15 years.

Recommendation Contact a qualified heating and cooling contractor

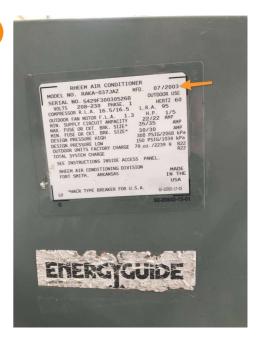

7.4.1 Hot Water Systems, Controls, Flues & Vents

BEYOND EXPECTED SERVICE LIFE



Water heater is beyond its expected service life. Recommend further evaluation by a licensed plumbing contractor.

Recommendation Contact a qualified plumbing contractor.



7.4.2 Hot Water Systems, Controls, Flues & Vents

WATER STAINS - LEAKAGE

Water stains were observed beneath water heater, indicating a past or present leak. Recommend further evaluation and repair by a qualified plumber.






7.4.3 Hot Water Systems, Controls, Flues & Vents HIGH WATER TEMPERATURE



Water temperature measured higher than the recommended 125 degrees Fahrenheit. Recommend lowering temperature.

Recommendation Contact a qualified plumbing contractor.

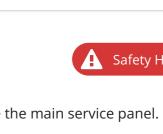

7.5.1 Fuel Storage & Distribution Systems GAS ODOR

Excessive gas odor was present around meter. Recommend consulting with your local utility company or qualified gas company to evaluate for potential leaks.

8.3.1 Branch Wiring Circuits, Breakers & Fuses

IMPROPER WIRING

A/C UNIT, MAIN SERVICE PANEL


Neutral branch circuit wire appears loose and not properly connected inside the main service panel. Recommend further review by a licensed electrical contractor.

Recommendation Contact a qualified electrical contractor.







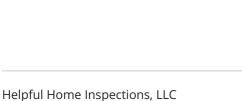

MAIN SERVICE PANEL Conductor not identified. Should be taped, typically

8.3.2 Branch Wiring Circuits, Breakers & Fuses

Conductor not identified. Should be taped, typically with red tape. Recommend further review by a licensed electrical contractor.

Recommendation Contact a qualified electrical contractor.

IMPROPER WIRING

8.4.2 Lighting Fixtures, Switches & Receptacles

BROKEN/MISSING WEATHER PROOF COVER ON EXTERIOR OUTLETS EXTERIOR

One or more exterior outlets are missing or have broken weather proof covers. Recommend review and replacement by a licensed electrical contractor.


Recommendation Contact a qualified electrical contractor.









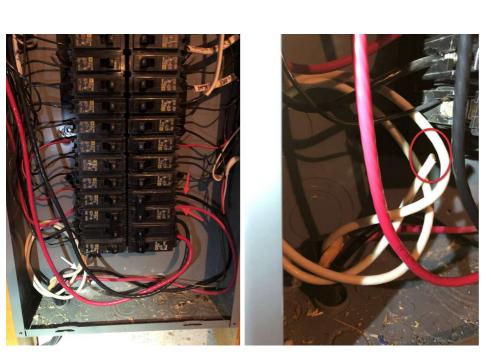





8.7.1 Carbon Monoxide Detectors NONE PRESENT

No carbon monoxide detectors present. Recommend installing.

Recommendation Contact a qualified professional.

🔒 Safety Hazard

11.1.1 Doors TORN SCREEN



Screen is torn on exterior sliding door. Recommend replacement.



11.2.1 Windows DAMAGED BEDROOM, GARAGE

One or more windows appears to have general damage. Recommend a window professional repair or if necessary replace the windows in question.



Garage



11.2.2 Windows **BROKEN GLASS** GARAGE



Window glass is broken. This is a safety hazard. Recommend immediate replacement by a qualified window repair and installation contractor.

Recommendation Contact a qualified window repair/installation contractor.



11.4.1 Walls HOLES MASTER BEDROOM

One or more holes were found in the interior walls. Recommend repair by a qualified drywall contractor.

Recommendation Contact a qualified drywall contractor.



