




This Summary outlines potentially significant issues from a cost, safety or urgency standpoint. This section is provided as a courtesy and cannot be considered a substitute for reading the entire report. Please read the complete document.

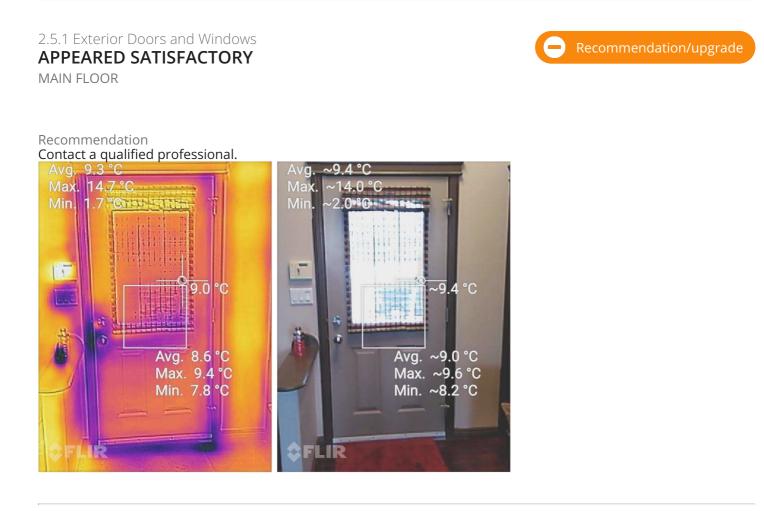

2.6.1 Decks, Balconies and Steps STEP HEIGHT EXCESSIVE DECK



The step height is greater than 8 inches which is considered excessive. Recommend correcting to help prevent trip hazards.

Recommendation Contact a qualified concrete contractor.



more than 8", caution while using it.

Recommendation/upgrade

2.6.2 Decks, Balconies and Steps MISSING FLASHING

DECK

The house is missing Z- flashing at the junction of the siding and the deck. Recommend installing to help prevent (further) moisture and rot damage.

Recommendation



2.7.1 Vegetation, Lot Drainage & Retaining Walls

TREE TO HOME CONTACT

- Recommendation/upgrade

The tree/bush is in contact with the home. This can cause damage to the siding and roofing materials, improper drainage to gutters and downspouts. Recommend trimming the tree back or removing to help prevent further damage and rodent access to the siding, roof and eaves.

Recommendation Contact a qualified landscaping contractor



2.7.2 Vegetation, Lot Drainage & Retaining Walls

VINES ON BUILDING

GARAGE

There are vines in contact with the building. Recommend re moving to help prevent damage.

Recommendation Contact a qualified landscaping contractor



3.1.1 Roof Coverings MOSS/DEBRIS ON ROOF

There was excessive moss and/or debris on the roof. Recommend cleaning to help prolong the life of the roof covering and prevent damage and leaks. Observed missing vent on porch area this could be another reasoning for high moisture around front porch roof.

Recommendation/upgrade

Recommendation

Contact a qualified roofing professional.







3.3.1 Side Wall Flashings MISSING KICK-OUT FLASHING BACK OF THE HOUSE

The roof was missing kick-out flashing at the bottom edge of the roof against the side-wall. Recommend installing to help prevent water intrusion behind the siding.

Recommendation/upgrade

Recommendation



3.4.1 Gutter, Downspouts, Extensions DOWNSPOUTS/GUTTER DISCHARGES ON ROOF

FRONT PORCH

The downspout or gutter discharges onto the roof below. This can cause premature wear of the shingles below. Recommend repair to help prolong the life of the shingles.

Recommendation Contact a qualified handyman.

3.4.2 Gutter, Downspouts, Extensions **GUTTERS FULL OF DEBRIS** UPPER ROOF AND LOWER ROOF

Debris has accumulated in the gutters. Recommend cleaning to facilitate water flow and void further damage to the soffit and other component.

Here is a DIY resource for cleaning your gutters.

Recommendation Contact a handyman or DIY project



signs of over flow

signs of over flow







3.4.3 Gutter, Downspouts, Extensions **GUTTER UNDERSIZED**

Recommendation/upgrade

Recommendation/upgrade

The gutters were too small for the distance/area covered. Recommend replacing with larger gutters and downspouts to help ensure run-off water drains away from the foundation.

Recommendation Contact a qualified siding specialist.

3.4.4 Gutter, Downspouts, Extensions EXTENSION MISSING

GARAGE

The extension for the downspout is loose. Recommend correcting to help prevent possible drainage issues.

Recommendation/upgrade

Recommendation Contact a handyman or DIY project

11.3.1 Floor Structure

SETTLING CONCRETE FLOOR GARAGE

The concrete floor has settled. Recommend monitoring for proper slope, cracks and trip hazards and making repairs as necessary.

Recommendation Contact a qualified concrete contractor.



Recommendation/upgrade

11.4.1 Crawlspace/Basement MINOR FOUNDATION CRACKS

Observed Minor Foundation cracks, recommend sealing the crack and monitoring.

Recommendation Contact a qualified professional.



InspecUs