

SUMMARY

1234 Main St. Truckee CA 96161

Buyer Name 05/29/2019 9:00AM



2.2.1 Flashing

NO FLASHING - EAVES



Metal flashing should be installed at the perimeter edges of the roof, including all eaves. Lack of flashing in these areas may affect roof sheathing, wood fascias, and siding.



2.2.2 Flashing

POOR FLASHING INSTALLATION



FRONT BAY WINDOW

Missing counter flashing. Counter-flashing may be a piece of metal or wood trim that is installed over the vertical leg of flashing to prevent moisture related issues. Sealant is not an adequate substitute. Horizontal leg of installed flashing should be under roofing

Recommendation

Contact a qualified roofing professional.





2.3.1 Chimney & Roof Penetrations

CHIMNEY IN POOR CONDITION



Sealant used to seal flashing around chimney vent. Bent vent stack above roof. Contact roofing contractor to repair flashing

Saturno Home Inspection Page 1 of 18

Recommendation Contact a qualified roofing professional.



3.1.1 Electrical Service

MISSING KNOCKOUTS



Hot conductors exposed. Recommend installing filler plates



4.1.1 Driveway & Walkway

ASPHALT DETERIORATION - DEFICIENT



Repair and/or monitor for expansion of cracks and further deterioration. Recommend sealing annually to extend life.

Saturno Home Inspection Page 2 of 18







4.1.2 Driveway & Walkway

DAMAGED CONCRETE



Concrete at walkway is damaged and deteriorated. Recommend repair to prevent a tripping hazard





4.4.2 Exterior Finishes

STONE VENEER DAMAGE



Damage to stone veneer observed, some missing rocks and cracked grout. Recommend replacing missing rocks and maintaining grout to extend the life of the veneer.

Recommendation

Contact a qualified masonry professional.

Saturno Home Inspection Page 3 of 18






4.4.3 Exterior Finishes

DAMAGED SIDING

Recommend replacing or patching cracks in damaged siding.



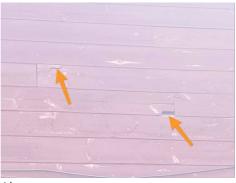

Above entry

4.5.1 Electrical

OUTLET(S) NOT GFCI PROTECTED





Recommendation

Contact a qualified electrical contractor.



Saturno Home Inspection Page 4 of 18

Deficient



4.6.1 Plumbing

HOSE BIB LEAKING

RIGHT OF ENTRY

Recommend replacing to prevent further leaking of hose bib.



4.8.2 Decks & Porches

MISSING FLASHING




No flashing between deck ledger and siding. Flashing at this location helps prevent moisture from getting behind ledger and siding that can cause damage. This can typically be retrofitted without many issues.

Deficient

Saturno Home Inspection Page 5 of 18



Ledger Flashing

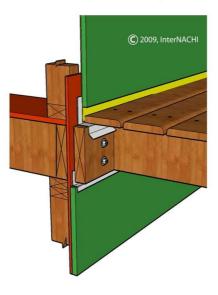

4.8.3 Decks & Porches


STRUCTURAL FAILURE

REAR DECK

Deck structure was of older construction and is a safety hazard. Missing hangers in several locations, settled footings, and inadequate framing. Recommend installing hangers on all deck joists to support beams.





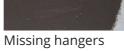



Deficient



Settled footing

Saturno Home Inspection Page 6 of 18



Settled footing

5.4.1 Doors

FRONT DOOR DOES NOT OPEN



FRONT DOOR

Right side of front door without hardware does not open. Door sweep may be interfering. Screws missing at metal piece at bottom of door.





Missing screws

5.4.2 Doors
MISSING TRANSITION PIECE
DOOR TO GARAGE



Saturno Home Inspection Page 7 of 18



5.5.1 Patio Door **MISSING LOCK**



Sliding patio door does not lock. Latch is missing on frame side.



5.7.1 Ceilings

WATER STAINS



Water stains on wood panel above the living room and down vent pipe. Unable to determine when these occurred or if the issue has been resolved. Contact seller for more information. Flashing at roof may be inadequate or poorly installed

Saturno Home Inspection Page 8 of 18





5.9.1 Smoke/ CO Detector

MISSING CO DETECTOR

Carbon monoxide detector is missing. This is required



Deficient

5.10.1 Fireplace

MISSING FIRE BRICKS

Recommend replacing fire bricks prior to use.

Recommendation

Contact a qualified fireplace contractor.





Damaged bricks

6.1.1 Electrical

NO POWER TO RECEPTACLE



MASTER BEDROOM

Receptacle was tested with a plug tester and did not have power at the time of inspection. Contact licensed electrical contractor for repair.

Recommendation

Contact a qualified electrical contractor.

Saturno Home Inspection Page 9 of 18



Top outlet only

Marginal

Deficient

6.2.1 Closets

MISSING DOORS



Missing closet doors. Hardware is installed. Doors observed in garage



6.5.1 Walls

POOR REPAIR

Wall behind guest bedroom door was repaired with poor craftsmanship. This area is soft and likely to be damaged again. Recommend replacing drywall section and screwing into studs.



6.7.1 Floors

MODERATE TO HEAVY WEAR

Recommend replacing carpet



7.5.1 Exhaust Fan

NO FAN INSTALLED, BUT WINDOW NOTED

MASTER BATHROOM

Bathroom does not have an exhaust fan installed but does have a window. When the house was built, a bath fan may not have been required. Recommend installing an exhaust fan in all bathrooms for proper ventilation and moisture control.

Saturno Home Inspection Page 10 of 18



7.6.1 Sinks SINK STOPPER IS INOPERABLE GUEST BATHROOM





7.10.1 Walls
MISSING TRIM
GUEST BATHROOM
Missing baseboard trim.





8.2.1 GFCI

OUTLET(S) NOT GFCI PROTECTED

ALL OUTLETS

All kitchen outlets should be GFCI protected. Recommend updating for safety

Recommendation

Contact a qualified electrical contractor.



8.4.1 Cabinets

CABINET POORLY ATTACHED TO WALL



Cabinet left of refrigerator is not adequately screwed to wall. Recommend repair for safety and to prevent damage to cabinet.



Saturno Home Inspection Page 11 of 18

8.4.2 Cabinets

CABINET OFF TRACKS



Cabinet drawer left of oven was off its track at time of inspection.



8.5.1 Sinks

FIXTURE IS LOOSE



Fixture is loose on sink basin or counter. Recommend tightening.



8.5.2 Sinks

IMPROPER P-TRAP



P-trap under kitchen sink is not a standard type. Install standard p-trap to prevent clogged drain

Recommendation

Contact a qualified plumbing contractor.



8.6.1 Cook Top and Range

NOT INSPECTED

Oven was unplugged at time of inspection. Not tested



8.7.1 Exhaust Fan

NO FAN INSTALLED



Recommend installing an exhaust fan per current code

Saturno Home Inspection Page 12 of 18



8.8.1 Dishwasher

NOT INSPECTED

Dishwasher was unplugged at time of inspection. Not tested



8.9.1 Garbage Disposal

DISPOSAL WAS INOPERABLE



Reset button was pushed on bottom of unit, but still did not operate. Recommendation

Contact a qualified appliance repair professional.



8.10.1 Refrigerator

REFRIGERATOR HAS BEEN UNPLUGGED

Not inspected



8.12.1 Walls

SMALL HOLE IN WALL



Call an exterior wall at lower cabinet right of sink. Recommend repair to prevent rodent intrusion. Evidence of rodent activity observed

Saturno Home Inspection Page 13 of 18



9.2.1 Dryer Vent

DISCONNECTED BEHIND DRYER





10.1.1 Water Heater

INSULATION WRAP



Unable to thoroughly inspect water heater or determine manufacturer information, including age, due to the insulation wrapped around tank water heater.



11.1.1 Heating

WALL HEATER NOT TESTED



Unable to test wall heater in guest bathroom. Control knob was missing

Saturno Home Inspection Page 14 of 18



12.2.1 GFCI

OUTLET(S) NOT GFCI PROTECTED



REAR WALL

All garage outlets should be GFCI protected. Recommend updating for safety

Recommendation Contact a qualified electrical contractor.



12.3.1 Walls/ Firewall

HOLE IN FIREWALL, ORGANIC GROWTH



REAR WALL

Organic growth and hole at rear wall with laundry drain. Replace drywall with organic growth. Repair hole for fire safety. The garage should be separated from the house and its attic area by at least 1/2 Inch continuous gypsum board (drywall) applied to the garage side. Garages beneath habitable rooms should be separated by at least 5/8-inch Type X gypsum board or equivalent.





12.7.1 Fire Door

THE SELF-CLOSING DEVICE ON FIRE DOOR ISN'T SET



The self-closing device on the door from the house leading to the garage does not function properly. This is a fire hazard. Recommend adjusting or replacing the hinges to allow for proper closure of the door.

Saturno Home Inspection Page 15 of 18



13.5.1 Plumbing

DAMAGED VENT PIPES



Two damaged plumbing vents observed in attic. Another vent is inadequately supported. Repair damaged vents and secure all existing vents to framing







14.2.1 Crawlspace

MOIST DIRT



Moisture in the crawlspace is normal this time of year. Recommend opening all vents to dry out the crawlspace area. Monitor space to ensure that soil dries before fungus begins to grow on surface.

Saturno Home Inspection Page 16 of 18





14.2.2 Crawlspace

NO INSULATION

ENTIRE CRAWLSPACE



No insulation was found in the crawlspace in between the floor framing members. Recommend installation of insulation between all framing members to increase the comfort and the efficiency of the home.

Recommendation Contact a qualified insulation contractor.





14.2.3 Crawlspace

POORLY INSTALLED INSULATION



Insulation installed on the walls of crawlspace are deteriorated and missing the bottom third of insulation do you to moisture and rodent intrusion. Recommend replacing with rigid insulation.



14.3.1 Venting

INSULATION COVERING VENTS



Recommend removing insulation from all vents to maintaining proper air flow and prevent moisture issues.

Saturno Home Inspection Page 17 of 18



14.5.1 Plumbing

UNINSULATED WATER PIPES OBSERVED IN UNHEATED CRAWLSPACE



Recommend insulating water pipes, installing heat tape, or both to prevent pipes from freezing



Saturno Home Inspection Page 18 of 18