

SUMMARY 1234 Main St.North Easton Massachusetts 02356

Dean Murphy
MA Lic Home Inspector #802
SHOVELTOWN HOME INSPECTIONS LLC
774-218-3288
dean@shoveltowninspections.com

Buyer Name 02/12/2019 9:00AM

2.1.1 Coverings

ORGANIC GROWTH - MOSS LICHENS



Roof shingles display organic growth, moss and lichen which can reduce roof life. Recommend a qualified roofing contractor evaluate and remedy with a roof cleaning or repair including metal roof strips. See link below:

Moss Removal

Recommendation Contact a qualified roofing professional.





2.2.1 Roof Drainage Systems


DOWNSPOUTS DISCHARGE TOO CLOSE TO FOUNDATION



Recommend adding 6' downspout extensions to move roof water at least 6' away from foundation. This will aid in keeping water/moisture out of basement.





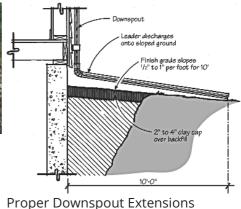

2.2.2 Roof Drainage Systems

DOWNSPOUTS DISCHARGE INTO IN-GROUND RECEPTORS

Recommendation

Monitor in-ground receptors as signs they are not taking water is present. Discharge on ground is better than backup.

 




2.2.3 Roof Drainage Systems

GUTTERS OVERFLOWING









3.1.1 Siding, Flashing & Trim

DETERIORATED WOOD TRIM AND PRIOR REPAIRS



Some deteriorated wood trim and/or siding noted. Keep all wood trim well painted. Recommend replacing all damaged wood trim with PVC type materials. Replace any heavily damaged siding.

Recommendation

Contact a qualified general contractor.





3.2.1 Exterior Doors and Windows

WATER DAMAGE TO WINDOW/DOOR TRIM/FRAME/SASHES



Water damage to door/frame/sashes noted. Recommend having contractor evaluate and repair or replace as needed. Damaged jambs/frames/sashes may require replacement.



3.2.2 Exterior Doors and Windows

WINDOW WELLS - MISSING



Window wells not present. Recommend installing window wells to protect basement windows and allow for proper grading.

Recommendation

Contact a qualified general contractor.



3.4.1 Decks, Balconies, Porches & Steps

Recommenda



Have contractor wash off mortar residue.

Recommendation
Contact a qualified professional.




3.5.1 Vegetation, Grading, Drainage & Retaining Walls

NEGATIVE GRADING



Grading is sloping towards the home in some areas. This could lead to water intrusion and foundation issues. Recommend qualified landscaper or foundation contractor regrade so water flows away from home.

Here is a helpful article discussing negative grading.

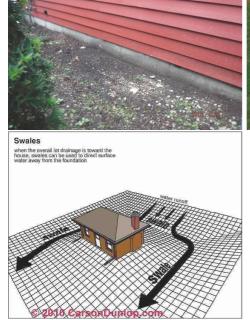





4.2.1 Flame and Fume Retarding

VOIDS NOTED

LAUNDRY ROOM

Safety Concern/Immediate Attention

Ensure all walls attached to living spaces are fully covered with wall board and fire-tape to minimize/slow fume and flame spread to living space.



5.1.1 Foundation

FOUNDATION - MINOR CRACKS



Minor shrinkage cracks noted at the foundation. This is common defect that occurs as concrete cures and shrinks. Recommend filling with hydraulic cement and monitor for any future movementd.

 
Recommendation

Contact a handyman or DIY project

5.2.1 Basement

ACTIVE WATER SEEPAGE





Recommendation

Contact a qualified professional.







5.2.2 Basement

MOLD-LIKE GROWTH

Safety Concern/Immediate Attention

Extensive mold-like growth noted throughout basement with recent unprofessional attempts at covering up several areas. Recommend having environmental specialist evaluate, remediate and provide all documentation. Abatement will most likely involve removal of walls and finishes in effected area. Risk of concealed damage.

Recommendation

Contact a qualified environmental contractor





6.2.1 Main & Subpanels, Service & Grounding, Main Overcurrent Device





DOUBLE TAPPING

Double Tapping at Breakers noted. This breaker is not manufactured to accept multiple wires connected to one breaker. Have Lic Electrician remove all double tap conditions.

Recommendation

Contact a qualified electrical contractor.

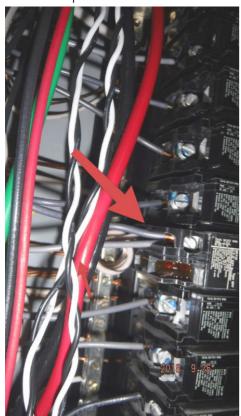

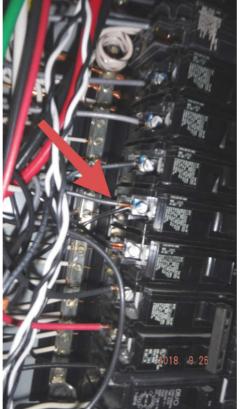

6.2.2 Main & Subpanels, Service & Grounding, Main Overcurrent Device



PANEL FULLY UTILIZED

Future electrical needs to require main panel replacement or additional sub panel. Have license electrician price panel replacement.

Recommendation

Contact a qualified electrical contractor.



6.4.1 Lighting Fixtures, Switches & Receptacles

COVER PLATES MISSING



One or more receptacles are missing a cover plate. This causes short and shock risk. Recommend installation of plates.





6.4.2 Lighting Fixtures, Switches & Receptacles

LIGHT FIXTURE BROKEN/DAMAGED/CORRODED

KITCHEN UNDERCABINET LUGHTS

Broken or damaged fixture. Have license electrician repair or replace.

Recommendation

Contact a qualified professional.



6.5.1 GFCI & AFCI

AFCI'S NOT PRESENT



AFCI's not present. Recommend upgrading circuit breakers to arc fault protected circuits.

AFCI's

7.2.1 Water Supply, Distribution Systems & Fixtures

Recommendation

TOILET FLUSH LEAKING/NOT FUNCTIONING PROPERLY

Repair or replace.

Recommendation Contact a qualified plumbing contractor.



7.5.1 Fuel Storage & Distribution Systems

OIL DRIPS ON FLOOR

Have oil delivery contractor evaluate fill pipes and reseal as necessary.

Recommendation Contact a qualified professional.

 






8.1.1 Equipment - Hydronic

OIL BOILER - OUTDATED/MISSING SERVICE TAGS





Recommendation

Contact a qualified heating and cooling contractor



8.1.2 Equipment - Hydronic

RUST AND CORROSION



Boiler has history of servicing yet boiler has excessive rust and corrosion at piping and components. Recommend having competent heating contractor fully evaluate and repair or replace any damage components.

Recommendation

Contact a qualified professional.







Safety Concern/Immediate Attention

8.4.1 Vents, Flues & Chimneys

FLUE PIPE NOT SEALED PROPERLY

Recommendation

Contact a qualified heating and cooling contractor





10.4.1 Baths/Showers

FAUCET NOT FUNCTIONING/LEAKING/DAMAGED/LOOSE

2ND FLOOR BATHROOM

Have plumbing contractor repair or replace.

Recommendation

Contact a qualified plumbing contractor.





Recommendation


10.6.1 Doors and Windows

WEATHERSTRIPPING MISSING/DAMAGED

REAR SUNROOM FRONT DOOR

Repair or replace to obtain tight seal at windows and doors.



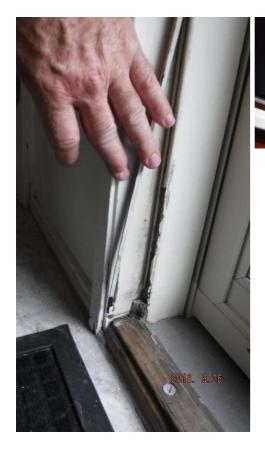





10.6.2 Doors and Windows

DOOR DAMAGE

Repair or replace.

Recommendation Contact a qualified professional.





10.7.1 Built-in appliances

MICROWAVE NOT FUNCTIONING/DAMAGED



Microwave appears to have power to Unit but not functioning. Have appliance repair person repair or replace.

Recommendation

Contact a qualified professional.



11.2.1 Insulation

INSULATION LESS THAN TODAY'S STANDARDS



Insulation depth was inadequate. Recommend a qualified insulation contractor install additional insulation. Contact MassSave for energy audit.

Recommendation

Contact a qualified insulation contractor.

11.4.1 Exhaust Systems

BATHROOM FAN DISCHARGING IN ATTIC



This can lead to high levels of moisture and associated mold growth. Have contractor properly terminate all exhaust fans at exterior of building.

Recommendation

Contact a qualified general contractor.



11.4.2 Exhaust Systems

NOISY FAN

Replace may be needed.

Recommendation

Contact a qualified electrical contractor.



