ROGUE INSPECTION SERVICES LLC 5415077674 travis@rogueinspection.com http://www.rogueinspection.com





RESIDENTIAL REPORT

1234 Main St. Jacksonville OR 97530

> Buyer Name 11/14/2018 9:00AM



Inspector Travis Hand OCHI #2150 5415077674 travis@rogueinspection.com



Inspector Ian Miller OCHI# 2214 5414992125 ian@rogueinspection.com



Agent Agent Name 555-555-5555 agent@spectora.com

Table of Contents

Table of Contents	2
SUMMARY	5
1: INSPECTION DETAILS	7
2: EXTERIOR	8
3: ROOF	15
4: BASEMENT, FOUNDATION, CRAWLSPACE & STRUCTURE	22
5: HEATING	25
6: COOLING	28
7: PLUMBING	30
8: ELECTRICAL	34
9: ATTIC, INSULATION & VENTILATION	38
10: DOORS, WINDOWS & INTERIOR	40
11: BUILT-IN APPLIANCES	43
12: GARAGE	45
13: PEST INSPECTION	48

INTRODUCTION, SCOPE, DEFINITIONS & COMPLIANCE STATEMENT

Introduction:

The following numbered and attached pages are your home inspection report. The report includes pictures, information, and recommendations. This inspection was performed in accordance with the current Standards of Practice and Code of Ethics of InterNACHI (International Association of Certified Home Inspectors). The Standards contain certain and very important limitations, expectations and exclusions to the inspection. A copy is available upon request.

Scope:

A home inspection is intended to assist in evaluating the overall condition of the dwelling. The inspection is based on observation of the visible, readily accessible and apparent condition of the structure and its components on this day. The results of this inspection are not intended to make any representation regarding the presence or absence of concealed defects that are not reasonably ascertainable or readily accessible in a competently performed inspection. No warranty, guarantee or insurance by Rogue Inspection Services, LLC is expressed or implied. This report does not include inspection for wood destroying insects, mold, lead or asbestos. A representative sampling of the building components is viewed in areas that are accessible at the time of the inspection. No destructive testing or dismantling of components is performed. Not all defects will be identified during this inspection. Unexpected repairs should be anticipated. The person conducting your inspection is not a Structural Engineer or other professional whose license authorizes the rendering of an opinion as to the structural integrity of a building or its other component parts. You are advised to seek two professional opinions and acquire estimates of repair as to any defects, comments, improvements or recommendations mentioned in this report. Rogue Inspection Services, LLC recommends that the professional making any repairs inspect the property further, in order to discover and repair related problems that were not identified in the report. We recommend that all repairs, corrections and cost estimates be completed and documented prior to closing or purchasing the property. Feel free to hire other professionals to inspect the property prior to closing, including Qualified HVAC, Plumbing, Electrical, Engineering and Roofing Contractors.

Use of photos:

Your report includes many photographs which help to clarify where the inspector went, what was looked at, and the condition of a system or component at the time of the inspection. Some of the pictures may be of deficiencies or problem areas, these are to help you better understand what is documented in this report and may allow you see areas or items that you normally would not see. A pictured issue does not necessarily mean that the issue was limited to that area only, but may be a representation of a condition that is in multiple places. Not all areas of deficiencies or conditions will be supported with photos.

Comment Key or Definitions:

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Deficiency (D) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

What really matters in a home inspection:

The process can be stressful. A home inspection is supposed to give you reassurance but often has the opposite effect. You will be asked to absorb a lot of information in a short time. This often includes a written report, checklist, photographs, environmental reports and what the inspector himself says during the inspection. All this combined with the seller's disclosure and what you notice yourself makes the experience even more overwhelming. What should you do? Relax. Most of your inspection will be maintenance recommendations, life expectancies and minor imperfections. These are nice to know about. However, the issues that really matter will fall into four categories: 1. Major defects. An example of this would be a significant structural failure. 2. Things that may lead to major defects. A small water leak coming from a piece of roof flashing, for example. 3. Things that may hinder your ability to finance, legally occupy or insure the home. Structural damaged caused by termite infestation, for example. 4. Safety hazards. Such as a lack of AFCI/GFCI outlet protection. Anything in these categories should be corrected. Often a serious problem can be corrected inexpensively to protect both life and property (especially in categories 2 and 4). Most sellers are honest and are often surprised to learn of defects uncovered during an inspection. Realize that sellers are under no obligation to repair everything mentioned in the report. No home is perfect.

SUMMARY



- O 2.1.1 Exterior Siding, Flashing & Trim: Flashing/Trim Improperly Installed
- O 2.1.2 Exterior Siding, Flashing & Trim: Seal Penetrations
- O 2.1.3 Exterior Siding, Flashing & Trim: Cracked sealant at trim joints
- O 2.1.4 Exterior Siding, Flashing & Trim: Failing paint
- O 2.1.5 Exterior Siding, Flashing & Trim: Dry Rot
- O 2.1.6 Exterior Siding, Flashing & Trim: Holes in siding
- O 2.3.1 Exterior Walkways, Patios & Driveways: Driveway Cracking Minor
- O 2.3.2 Exterior Walkways, Patios & Driveways: Patio Cracking Minor
- 2.4.1 Exterior Decks, Balconies, Porches & Steps: Missing Handrail
- O 2.4.2 Exterior Decks, Balconies, Porches & Steps: Unfinished Porch
- O 2.5.1 Exterior Eaves, Soffits & Fascia: Paint/Finish Failing
- O 2.6.1 Exterior Vegetation, Grading, Drainage & Retaining Walls: Trim Vegetation
- ⊖ 3.1.1 Roof Coverings: Under-Driven Nails
- 3.1.2 Roof Coverings: Moss Minor
- 🕒 3.2.1 Roof Roof Drainage Systems: Downspouts Drain Near House
- ⊖ 3.2.2 Roof Roof Drainage Systems: Gutters Need Sealant
- O 3.2.3 Roof Roof Drainage Systems: Damaged Downspout
- O 3.2.4 Roof Roof Drainage Systems: Gutter screen damaged
- 3.3.1 Roof Flashings: Step flashing improperly installed
- O 3.4.1 Roof Skylights, Chimneys & Other Roof Penetrations: Skylight Water Penetration
- O 3.4.2 Roof Skylights, Chimneys & Other Roof Penetrations: Vent Boot Cracked
- O 4.1.1 Basement, Foundation, Crawlspace & Structure Foundation: Foundation Cracks Minor
- O 4.1.2 Basement, Foundation, Crawlspace & Structure Foundation: Efflorescence
- 🕒 5.1.1 Heating Equipment: Inadequate Heat
- ⊖ 5.3.1 Heating Distribution Systems: Duct Damaged

Θ

7.3.1 Plumbing - Water Supply, Distribution Systems & Fixtures: Hot and cold water lines reversed on bathroom sink

• 7.4.1 Plumbing - Hot Water Systems, Controls, Flues & Vents: Insufficient Strapping

Θ

- 7.4.2 Plumbing Hot Water Systems, Controls, Flues & Vents: No Temperature & Pressure Relief Extension
- 8.2.1 Electrical Main & Subpanels, Service & Grounding, Main Overcurrent Device: Missing panel screws
- ⊖ 8.4.1 Electrical Lighting Fixtures, Switches & Receptacles: Cover Plates Missing
- ⊖ 8.6.1 Electrical Smoke Detectors: Additional Smoke Detectors
- ⊖ 9.5.1 Attic, Insulation & Ventilation Exhaust Systems: Damaged dryer damper
- ⊖ 10.1.1 Doors, Windows & Interior Doors: Door trim missing
- O 10.2.1 Doors, Windows & Interior Windows: Window hardware damaged
- O 10.2.2 Doors, Windows & Interior Windows: Water damage
- O 10.2.3 Doors, Windows & Interior Windows: Paint failing
- O 11.1.1 Built-in Appliances Dishwasher: Create High Loop
- ⊖ 12.4.1 Garage Garage Door: Recommend Steps
- O 12.7.1 Garage Windows: Broken Seal
- O 13.7.1 Pest Inspection Crawlspace: Signs of Rodents

1: INSPECTION DETAILS

Information

In Attendance Client, Inspector

Style Multi-level

Outdoor temperature 42 Fahrenheit (F) **Occupancy** Vacant

Age of Building Under 25 years

Weather Conditions Clear **Type of Building** Single Family

Home Faces South

Soil Conditions Dry

Limitations

General **PHOTOS ARE REPRESENTATIVE**

Photos are only a representative sample of conditions observed. There may be more than one area of concern not shown by photo

2: EXTERIOR

		IN	NI	NP	D
2.1	Siding, Flashing & Trim	Х			Х
2.2	Exterior Doors	Х			
2.3	Walkways, Patios & Driveways	Х			Х
2.4	Decks, Balconies, Porches & Steps	Х			Х
2.5	Eaves, Soffits & Fascia	Х			Х
2.6	Vegetation, Grading, Drainage & Retaining Walls	Х			Х
	IN = Inspected NI = Not Inspected NP = Not Pre	esent	D =	= Defici	encies

IN = Inspected NI = Not Inspected NP = Not Present

Information

Siding, Flashing & Trim: Siding Material Stone Veneer, Wood	Siding, Flashing & Trim: Siding Style Lap	Exterior Doors: Exterior Entry Door Glass, Steel, Wood
Walkways, Patios & Driveways: Driveway Material Asphalt, Concrete, Pavers	Walkways, Patios & Driveways: Appurtenance Sidewalk, Covered Porch, Patio	Decks, Balconies, Porches & Steps: Appurtenance Deck with Steps, Patio, Covered patio
Decks, Balconies, Porches & Steps: Material Concrete, Wood	Vegetation, Grading, Drainage & Retaining Walls: Grounds Moderate Slope	

Deficiencies

2.1.1 Siding, Flashing & Trim FLASHING/TRIM IMPROPERLY

FLASHING/TRIM IMPROPERLY INSTALLED GARAGE

Flashing & trim pieces were improperly installed, which could result in moisture intrusion and damaging leaks. Recommend a qualified siding contractor evaluate and install flashing over all horizontal trim.

Recommendation Contact a qualified siding specialist. - Recommendation



2.1.2 Siding, Flashing & Trim **SEAL PENETRATIONS**

GARAGE

There are holes that are exposed on the exterior siding. Recommend sealing to prevent water damage to the siding.

Recommendation Contact a qualified professional.





2.1.3 Siding, Flashing & Trim

CRACKED SEALANT AT TRIM JOINTS

The sealant at the trim joints and window trim has deteriorated and cracked. Recommend re-sealing to prevent moisture damage.

Recommendation Recommended DIY Project Recommendation



2.1.4 Siding, Flashing & Trim

FAILING PAINT

SOUTH

The paint is failing on various locations around the house and the wood is exposed. Recommend painting to provide a waterproof barrier and to prevent dry Rot.

Recommendation

Contact a qualified painter.







2.1.5 Siding, Flashing & Trim

DRY ROT GARAGE

There is dry rot present on the exterior trim in some areas. Recommend repair as needed.

Recommendation Contact a qualified siding specialist.





2.1.6 Siding, Flashing & Trim

HOLES IN SIDING

WEST(DECK)

Recommend replacement of sections that are damaged to prevent damage to structure from water and pests.

Recommendation Contact a qualified professional.





2.3.1 Walkways, Patios & Driveways

DRIVEWAY CRACKING - MINOR DRIVEWAY

Minor cosmetic cracks observed, which may indicate movement in the soil. Recommend monitor and/or have concrete contractor patch/seal.

Recommendation Recommend monitoring.





2.3.2 Walkways, Patios & Driveways

PATIO CRACKING - MINOR PATIO AND STEPS

Normal settling & cracking observed. Recommend monitor and/or patch/seal. Recommendation Recommend monitoring.





2.4.1 Decks, Balconies, Porches & Steps

MISSING HANDRAIL WEST

Handrail is missing around the patio on the west side of the house. A handrail should be installed for safety.

Recommendation Contact a qualified professional.





2.4.2 Decks, Balconies, Porches & Steps

UNFINISHED PORCH

BASEMENT

Interior of basement porch is exposed to elements and/or pests due to it being unfinished. Recommend repair/finishing as desired.

Recommendation

Contact a qualified professional.





2.5.1 Eaves, Soffits & Fascia

PAINT/FINISH FAILING GARAGE

The paint or finish is failing on the fascia in one or more locations. I recommend repainting to prevent water damage to the wood.

Recommendation Contact a qualified painter.







TRIM VEGETATION

Keep vegetation trimmed and away from the house. It creates a pathway for insects and rodents and can create prolonged moisture contact with the siding and trim.

Recommendation Recommended DIY Project



3: ROOF

		IN	NI	NP	D
3.1	Coverings	Х			Х
3.2	Roof Drainage Systems	Х			Х
3.3	Flashings	Х			Х
3.4	Skylights, Chimneys & Other Roof Penetrations	Х			Х
	IN = Inspected NI = Not Inspected NP = Not Pre	esent	D :	= Defici	encies

IN = Inspected NI = Not Inspected NP = Not Present

Information

Inspection Method Roof	Roof Drainage Systems: Gutter Material Aluminum	Flashings: Material Aluminum
Skylights, Chimneys & Other Roof Penetrations: Skylights Two	Skylights, Chimneys & Other Roof Penetrations: Chimney (exterior) None	

Life Expectancy 5-7 Years

Asphalt Shingles


Roof was in good condition at the time of inspection. Estimate 5-7 years of remaining life.

Life Expectancy 10+ Years

Concrete Tiles

The roof was in good condition at the time of inspection. estimate 10+ years of remaining life on the roof.

Coverings: Material Asphalt, Concrete, Tile

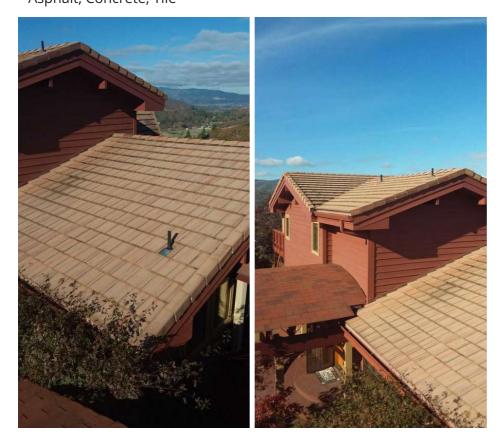

Coverings: Life Expectancy

As prescribed in the inspection authorization and agreement, this is a visual inspection only. Roofing life expectancy can vary depending on several factors. Any estimates of remaining life are approximations only.

Limitations

General LEAKS UNPREDICTABLE

ROOF COVERING

Roofs are designed to shed water like an umbrella and are not waterproof. In events of wind driven rains, and periods of intense rain, water can sometimes blow into areas such as ridge vents, roof vents and valleys and present leaking conditions. This occurrence is rare, but can possibly happen in severe storm events. Unless it is raining at the time of inspection, some roof leaks may not be identified during the inspection process.

Deficiencies

3.1.1 Coverings

UNDER-DRIVEN NAILS

NORTH

Observed one or more under-driven nails/fasteners. Recommend a qualified roofing contractor evaluate and repair. In at least one observed area, the under-driven nail has penetrated the upper layer of shingles.

Contact a qualified roofing professional.



3.1.2 Coverings

MOSS - MINOR

There is minor moss growth on the north side of the roof. Recommend evaluation and treatment as needed.

Recommendation

Contact a qualified professional.







One or more downspouts drain too close to the home's foundation. This can result in excessive moisture in the soil at the foundation, which can lead to foundation/structural movement. Recommend a qualified contractor adjust downspout extensions to drain at least 6 feet from the foundation.

Here is a helpful DIY link and video on draining water flow away from your house.

Recommendation Recommended DIY Project



3.2.2 Roof Drainage Systems

GUTTERS NEED SEALANT

JOINTS

The sealant at the seams and gutter joints has deteriorated and is in need of repair. Recommend repair by a licensed gutter professional to ensure that all seams are properly sealed to prevent leaks.

Recommendation Contact a qualified gutter contractor





3.2.3 Roof Drainage Systems

DAMAGED DOWNSPOUT

SOUTH

The underground downspout connection is damaged. Recommend repair to prevent water from draining near the foundation.

Recommendation

Contact a qualified professional.





3.2.4 Roof Drainage Systems GUTTER SCREEN DAMAGED

NORTH

Screen is loose or damaged, recommend replacing with proper gutter screen.

Recommendation Contact a qualified professional.





3.3.1 Flashings

STEP FLASHING IMPROPERLY INSTALLED

NORTH

The step flashing on the dormer is improperly installed. Recommend repair and proper installation by a licensed roofing contractor.

Recommendation

Contact a qualified roofing professional.





3.4.1 Skylights, Chimneys & Other Roof Penetrations

SKYLIGHT WATER PENETRATION

There are signs of possible water penetration at or near the skylight. Skylights, if not properly installed, are prone to leaking. Monitor the condition and if there is sign of leak then have the skylight repaired or replaced.

Proper flashing around the skylight is critical.

Recommendation

Contact a qualified professional.





3.4.2 Skylights, Chimneys & Other Roof Penetrations

VENT BOOT CRACKED

WEST

The vent boot is cracked and in need of replacement. Recommend replacing to prevent water from entering the attic.

Recommendation

Contact a qualified roofing professional.





4: BASEMENT, FOUNDATION, CRAWLSPACE & STRUCTURE

		IN	NI	NP	D
4.1	Foundation	Х			Х
4.2	Basements & Crawlspaces	Х			
4.3	Floor Structure	Х			
4.4	Wall Structure	Х			
4.5	Ceiling Structure		Х		
4.6	Roof Structure & Attic		Х		
	IN = Inspected NI = Not Inspected NP = Not Pre	sent	D =	= Defici	encies

Information

Foundation: Material Masonry Block

Basements & Crawlspaces:

Crawlspace Entry West Exterior Basements & Crawlspaces: Method of Observation Crawled



Basements & Crawlspaces: Columns or Peirs Wood Piers, Supporting Walls

Floor Structure: Sub-floor Plywood Floor Structure: Basement/Crawlspace Floor Concrete

Ceiling Structure: Ceiling Structure Not Visible Floor Structure: Floor Structure Wood Beams, 2x6

Roof Structure & Attic: Material Inaccessible

Roof Structure & Attic: Type Gable	Roof Structure & Attic: Roof Structure Not Visible	Roof Structure & Attic: Attic Info No Access
Roof Structure & Attic: Method of Observation		

Limitations

Not Accessible

Ceiling Structure **NO ACCESS** VAULTED CEILINGS There was no attic access.

Roof Structure & Attic **NO ACCESS** VAULTED CEILING There was no attic access.

Deficiencies

4.1.1 Foundation FOUNDATION CRACKS - MINOR

FOUNDATION

Minor cracking was noted at the foundation. This is common as concrete ages and shrinkage surface cracks are normal. Recommend monitoring for more serious shifting/displacement.

Here is an informational article on foundation cracks.

Recommendation Recommend monitoring.





4.1.2 Foundation

EFFLORESCENCE

SEVERAL LOCATIONS

Water staining on foundation indicates that gutters may be clogged and causing moisture to be absorbed into foundation. Recommend maintenance on gutters drainage system to direct water away from home. Also, ensure that the sprinkler system is not hitting the siding/foundation.

Recommendation Recommend monitoring.





5: HEATING

		IN	NI	NP	D
5.1	Equipment	Х			Х
5.2	Normal Operating Controls	Х			
5.3	Distribution Systems	Х			Х
5.4	Presence of Installed Heat Source in Each Room	Х			
			-	D	

Equipment: Energy Source

Electric

IN = Inspected NI = Not Inspected NP = Not Present

Equipment: Heat Type Forced Air, Heat Pump

D = Deficiencies

Information

Equipment: Brand

Frigidaire



Equipment: Filter Type Disposable Equipment: Filter Size

20x20

Equipment: Manufacture Date 1999 Year



Equipment: Working

The furnace was in good working condition at time of inspection.

Normal Operating Controls: Thermostat Hallway Wall

The thermostat was operable.

Distribution Systems: Ductwork



Deficiencies

5.1.1 Equipment **INADEQUATE HEAT**

Furnace was operating at the time of inspection, however very little or no heat was produced. Recommend a qualified HVAC technician evaluate and repair.

Recommendation

Contact a qualified HVAC professional.

5.3.1 Distribution Systems

DUCT DAMAGED

CRAWLSPACE EAST

Air supply duct has water inside. Recommend a qualified HVAC contractor repair.

Recommendation Contact a qualified HVAC professional.







6: COOLING

		IN	NI	NP	D
6.1	Cooling Equipment		Х		
6.2	Normal Operating Controls		Х		
6.3	Distribution System	Х			
6.4	Presence of Installed Cooling Source in Each Room	Х			
	IN = Inspected NI = Not Inspected NP = Not Pre	esent	D	= Defici	encies

Information

Cooling Equipment: Brand

Copeland

Cooling Equipment: Energy Source/Type Electric, Central Air Conditioner, Heat Pump

Cooling Equipment: Location Exterior West



Cooling Equipment:

Manufacture Date West 1999 Manufacture Date



Limitations

Cooling Equipment: Maintenance

Recommend maintenance annually.

Distribution System: Configuration Central

Cooling Equipment

WEST

The A/C unit was not tested due to low outdoor temperature (<65 Degrees). This may cause damage the unit.

Normal Operating Controls
OUTDOOR TEMPERATURE WAS BELOW 65, UNSAFE TO OPERATE A/C

7: PLUMBING

		IN	NI	NP	D
7.1	Main Water Shut-off Device	Х			
7.2	Drain, Waste, & Vent Systems	Х			
7.3	Water Supply, Distribution Systems & Fixtures	Х			Х
7.4	Hot Water Systems, Controls, Flues & Vents	Х			Х
7.5	Fuel Storage & Distribution Systems			Х	
7.6	Sump Pump			Х	
	IN = Inspected NI = Not Inspected NP = Not Pre	esent	D :	= Defici	encies

Information

Filters

Sediment Filter, System flush, Whole house conditioner Water Source Well Main Water Shut-off Device: Location Basement



Drain, Waste, & Vent Systems: Drain Size 2" Drain, Waste, & Vent Systems: Material ABS Water Supply, Distribution Systems & Fixtures: Distribution Material Copper

Water Supply, Distribution Systems & Fixtures: Water Supply Material Copper

Hot Water Systems, Controls, Flues & Vents: Capacity 80 gallons

Hot Water Systems, Controls, Flues & Vents: Location Basement



Hot Water Systems, Controls, Flues & Vents: Power Source/Type Electric Hot Water Systems, Controls, Flues & Vents: Manufacture Date 2008 Year Fuel Storage & Distribution Systems: Main Gas Shut-off Location None



Fuel Storage & Distribution Systems: Appliances on Gas None

Hot Water Systems, Controls, Flues & Vents: Manufacturer


Whirlpool

I recommend flushing & servicing your water heater tank annually for optimal performance. Water temperature should be set to at least 120 degrees F to kill microbes and no higher than 130 degrees F to prevent scalding.

Here is a nice maintenance guide from Lowe's to help.

Hot Water Systems, Controls, Flues & Vents: Working

The hot water heater was in good working condition at the time of inspection.

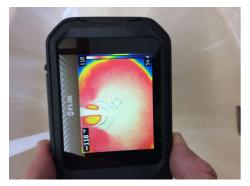

Deficiencies

7.3.1 Water Supply, Distribution Systems & Fixtures

HOT AND COLD WATER LINES REVERSED ON BATHROOM SINK

BATHROOM

Recommend repair by licensed plumber

Recommendation Contact a qualified professional.



7.4.1 Hot Water Systems, Controls, Flues & Vents



INSUFFICIENT STRAPPING

The water heater is not properly strapped. A strap should be on the upper 1/3 an the lower 1/3, secured to the studs in the wall. Recommend repair.

Recommendation Contact a qualified professional.



7.4.2 Hot Water Systems, Controls, Flues & Vents



NO TEMPERATURE & PRESSURE RELIEF EXTENSION

An extension should be placed on the T&P valve that extends within 6 inches of the floor. Recommend repair by a licensed plumber.

Recommendation Contact a qualified plumbing contractor.



8: ELECTRICAL

		IN	NI	NP	D
8.1	Service Entrance Conductors	Х			
8.2	Main & Subpanels, Service & Grounding, Main Overcurrent Device	Х			Х
8.3	Branch Wiring Circuits, Breakers & Fuses	Х			
8.4	Lighting Fixtures, Switches & Receptacles	Х			Х
8.5	GFCI & AFCI	Х			
8.6	Smoke Detectors	Х			Х
8.7	Carbon Monoxide Detectors	Х			
	IN = Inspected NI = Not Inspected NP = Not Pre	esent	D :	= Defici	encies

Main & Subpanels, Service &

Device: Main Panel Location

West (Exterior)

Grounding, Main Overcurrent

Information

Service Entrance Conductors: Electrical Service Conductors

Below Ground, 220 Volts



Main & Subpanels, Service & Grounding, Main Overcurrent Device: Panel Manufacturer Siemens Main & Subpanels, Service & Grounding, Main Overcurrent Device: Panel Type Circuit Breaker Main & Subpanels, Service & Grounding, Main Overcurrent Device: Panel Capacity 200 AMP

Branch Wiring Circuits, Breakers & Fuses: Branch Wire 15 and 20 AMP Copper

Branch Wiring Circuits, Breakers & Fuses: Wiring Method Romex

Branch Wiring Circuits, Breakers & Fuses: Panel with cover removed Basement



Main & Subpanels, Service & Grounding, Main Overcurrent Device: Sub Panel Location Garage, Basement



GFCI & AFCI: Good working condition

The GFCI outlets were installed in the correct areas and in good working condition at the time of inspection.

Smoke Detectors: Smoke Detectors

3

The smoke detector should be tested at common hallway to bedrooms upon moving in to home. For many years NFPA 72, National Fire Alarm and Signaling Code, has required as a minimum that smoke alarms be installed inside every sleep room (even for existing homes) in addition to requiring them outside each sleeping area and on every level of the home.

Smoke Detectors: Test Smoke Detectors

Recommend testing all smoke and CO2 detectors upon moving into the home. According to the U.S. Fire Administration (USFA), smoke detectors should be tested at least once a month and batteries should be replaced at least once or twice a year.

Deficiencies

8.2.1 Main & Subpanels, Service & Grounding, Main Overcurrent Device

MISSING PANEL SCREWS

BASEMENT

The main panel is missing screws that hold the cover in place. Recommend replacing with flat head compressed thread screws.

Recommendation Contact a handyman or DIY project



8.4.1 Lighting Fixtures, Switches & Receptacles



COVER PLATES MISSING

BEDROOM WEST

One or more receptacles are missing a cover plate. This causes short and shock risk. Recommend installation of plates.

Recommendation

Recommended DIY Project



8.6.1 Smoke Detectors ADDITIONAL SMOKE DETECTORS

- Recommendation

For many years NFPA 72, National Fire Alarm and Signaling Code, has required as a minimum that smoke alarms be installed inside every sleep room (even for existing homes) in addition to requiring them outside each sleeping area and on every level of the home. Recommend installing smoke detectors in sleeping rooms. Recommend installing per manufacture recommendations.

Recommendation Recommended DIY Project

9: ATTIC, INSULATION & VENTILATION

		IN	NI	NP	D
9.1	Attic Insulation		Х		
9.2	Floor insulation	Х			
9.3	.3 Vapor Retarders (Crawlspace or Basement)				
9.4	Attic & Crawlspace Ventilation	Х			
9.5	Exhaust Systems	Х			Х
	IN = Inspected NI = Not Inspected NP = Not Pre	esent	D =	= Defici	encies

IN = Inspected NI = Not Inspected NP = Not Present

Information

Attic Insulation: Insulation Type Floor insulation : Floor Not Visible insulation

Batts



Vapor Retarders (Crawlspace or **Basement): Good Condition** Crawlspace

The vapor retarder is installed and in good condition.



Attic & Crawlspace Ventilation: **Ventilation Type** Gable Vents, Passive, Soffit Vents **Exhaust Systems: Exhaust Fans** Fan Only

Exhaust Systems: Dryer Power Source 220 Volt

Exhaust Systems: Dryer Vent Metal - Flex

Limitations

Attic Insulation

NO ACCESS

VAULTED CEILINGS

There is no attic access. I was unable to inspect for insulation.

Deficiencies

9.5.1 Exhaust Systems

DAMAGED DRYER DAMPER WEST

The dryer vent on the exterior on the house is damaged and can allow pests to enter the duct. Recommend replacing damper.

Recommendation

Contact a qualified professional.





10: DOORS, WINDOWS & INTERIOR

		IN	NI	NP	D
10.1	Doors	Х			Х
10.2	Windows	Х			Х
10.3	Floors	Х			
10.4	Walls	Х			
10.5	Ceilings	Х			
10.6	Steps, Stairways & Railings	Х			
10.7	Countertops & Cabinets	Х			
10.8	Bathrooms	Х			
	IN = Inspected NI = Not Inspected NP = Not Pre	sent	D =	Defici	encies

Information

Doors: Interior Doors Solid, Wood

Floors: Floor Coverings Carpet, Hardwood, Tile

Countertops & Cabinets: Cabinetry Wood Windows: Window Manufacturer Windows: Window TypeUnknownCasement, Single Pane, Awning

Walls: Wall Material Drywall

Countertops & Cabinets: Countertop Material Granite Ceilings: Ceiling Material Drywall

Limitations

General

COSMETIC ISSUES NOT ADDRESSED

Issues that are considered as cosmetic are not addressed in this report. (Holes, stains, scratches, unevenness, missing trim, paint and finish flaws or odors). It is not the intent of this report to make the house new again.

Deficiencies

10.1.1 Doors DOOR TRIM MISSING

MASTER BATH

Recommend installing wood trim on door for finished appearance.

Recommendation

Contact a qualified professional.





10.2.1 Windows WINDOW HARDWARE DAMAGED

MASTER BATHROOM

The window on the east side of the house does not lock. Recommend replacement.

Recommendation Contact a qualified handyman.





10.2.2 Windows

WATER DAMAGE

WINDOW FRAME

There is water damage at one or more windows. Recommend resealing to prevent further damage.

Recommendation Contact a qualified handyman.





10.2.3 Windows

PAINT FAILING

WINDOW FRAMES

Recommend resealing to prevent further damage to window

Recommendation

Contact a qualified professional.





11: BUILT-IN APPLIANCES

		IN	NI	NP	D
11.1	Dishwasher	Х			Х
11.2	Range/Oven/Cooktop	Х			
11.3	Garbage Disposal			Х	
11.4	Built-in Microwave			Х	
11.5	Refrigerator		Х		
11.6	Range Hood			Х	
	IN = Inspected NI = Not Inspected NP = Not Pr	esent	D = Deficiend		encies

Information

Dishwasher: Brand Maytag

Range/Oven/Cooktop: Range/Oven Brand Maytag Range/Oven/Cooktop: Range/Oven Energy Source Electric

Refrigerator: Brand

Whirlpool

Dishwasher: Working

Kitchen

The dishwasher was in good working condition at the time of inspection. It was run on a rinse cycle.

Range/Oven/Cooktop: Working

Kitchen

The cooktop and oven were tested and in good working condition at the time of inspection.

Limitations

Refrigerator UNPLUGGED KITCHEN

Deficiencies

11.1.1 Dishwasher

CREATE HIGH LOOP



Recommend creating a high loop with the dishwasher drain line to prevent backflow from the kitchen sink.

Recommendation Recommended DIY Project



12: GARAGE

		IN	NI	NP	D
12.1	Ceiling	Х			
12.2	Floor	Х			
12.3	Walls & Firewalls	Х			
12.4	Garage Door	Х			Х
12.5	Overhead Door & Opener	Х			
12.6	Occupant Door (From garage to inside of home)			Х	
12.7	Windows	Х			Х
IN = Inspected NI = Not Inspected NP = Not Present		D =	= Defici	encies	

Information

Garage Door: Material Steel	Overhead Door & Opener: Type Automatic	Overhead Door & Opener: Brand Chamberlain
Overhead Door & Opener: Material Metal		
Floor: Typical Settlement Cracks		

Garage

Cracks in the garage floor slab are typical. They are not indicative of structural issues.

Deficiencies

12.4.1 Garage Door

RECOMMEND STEPS

GARAGE WEST

Recommend installing steps on the exterior door of the garage.

Recommendation Contact a qualified professional.





12.7.1 Windows

BROKEN SEAL

GARAGE

Several of the seals on the garage windows are broken, recommend a window contractor to evaluate and replace the window sashes.

Recommendation

Contact a qualified window repair/installation contractor.



13: PEST INSPECTION

		IN	NI	NP	D
13.1	Exterior	Х			
13.2	Deck	Х			
13.3	Garage	Х			
13.4	Outbuildings			Х	
13.5	Interior	Х			
13.6	Attic	Х			
13.7	Crawlspace	Х			Х
	IN = Inspected NI = Not Inspected NP = Not Pre	esent	D =	= Defici	encies

Information

Type Rodents Evidence Feces **Crawlspace: Pest activity observed in crawlspace** Crawlspace floor

Recommend baiting as needed.



Limitations

General
FUTURE INFESTATIONS

Future infestations of vermin, insects or other animal activity can not be known or predicted.

Deficiencies

13.7.1 Crawlspace SIGNS OF RODENTS



Rogue Inspection Services LLC

There were signs of rodents in the crawlspace. I was unable to determine if it is old or active. Recommend baiting as needed.

Recommendation Contact a qualified pest control specialist.