

CAL-PRO REAL ESTATE INSPECTIONS

(661) 873-5200

calpro@calproinspections.com http://www.CalProInspections.com



PROPERTY INSPECTION REPORT COPY

1234 Main St. Bakersfield California 93306

Buyer Name 02/13/2018 9:00AM



Inspector
Mike Hazelwood
InterNACHI #0731201
(661) 873-5200
calpro@calproinspections.com



Agent Name 555-555-555 agent@spectora.com

Table of Contents

Table of Contents	2
SUMMARY	3
1: GENERAL INFORMATION / OVERVIEW	5
2: INSPECTION / PROPERTY DETAILS	7
3: MISC. CONCERNS / COMMENTS	8
4: GROUNDS	10
5: EXTERIOR	12
6: ROOF	13
7: GARAGE / CARPORT	15
8: INTERIOR, DOORS, WINDOWS	16
9: PLUMBING	20
10: ELECTRICAL	27
11: BUILT-IN APPLIANCES	32
12: HVAC	34
13: FIREPLACES AND FUEL-BURNING APPLIANCES	38
14: FOUNDATION	39
15: ATTIC, INSULATION & VENTILATION	40
16: POOL	41

SUMMARY

☐ Misc. Concerns / Comments - Misc. Concerns / Comments: Microbial Like Growths
☐ Misc. Concerns / Comments - Misc. Concerns / Comments: Rodent Evidence
☐ Grounds - Vegetation: Vegetation Too Close / In Contact with Building
☐ Grounds - Grading: Soil in Contact with Stucco, Brick and/or Stone (faulty grading)
☐ Grounds - Fences/Gates: Fence Repair - Minor
☐ Grounds - Driveways, Sidewalks, Patios: Sidewalk / Patio Cracks / Deterioration - Trip Hazard - Repair
☐ Garage / Carport - Occupant Doors: Door Not Fire Resistant
☐ Garage / Carport - Floor, Walls, Ceiling: Unprotected Furnace
□ Plumbing - Supply Lines: Hose Bib Leaked While Off
□ Plumbing - Supply Lines: Hose Bib Leaked While On
□ Plumbing - Supply Lines: Hose Bib Missing Backflow Preventer
□ Plumbing - Supply Lines: Exterior Hose bib Not Secure
□ Plumbing - Sinks / Fixtures: Flexible Pipe
☐ Plumbing - Sinks / Fixtures: Drain Leak
□ Plumbing - Sinks / Fixtures: Drain Lines / Fittings Corroded
□ Plumbing - Sinks / Fixtures: Water Filter Service Spout Damaged / Inoperable
☐ Plumbing - Water Heater: Lifespan (8-12 yrs)
☐ Plumbing - Water Heater: Stains / Damage Below / Around Water Heater
□ Plumbing - Irrigation: Sprinkler Heads Clogged
□ Plumbing - Irrigation: Sprinklers Hitting Structure.
□ Plumbing - Service: Main Leaking
☐ Plumbing - Laundry: Dryer Vent Needs Cleaning - Now
☐ Plumbing - Drain, Waste, & Vent Systems: SewerScan Issues
□ Plumbing - Toilets / Bidets: Toilet Loose
☐ Built-in Appliances - Dishwasher: Not Secure, Missing / Damaged Screw(s) and/or Bracket(s)
☐ Built-in Appliances - Range/Oven/Cooktop: Cooktop / Stove Burner Ignitor(s) Do Not Shut Off
☐ Fireplaces and Fuel-Burning Appliances - Fireplaces, Stoves & Inserts: Gaps Face/Firebox
☐ Fireplaces and Fuel-Burning Appliances - Chimney(s): Chimney Sweep / Cleaning Needed
□ Pool - Fences / Gates / Barriers: Alarms on Doors Inoperable
□ Pool - Fences / Gates / Barriers: Fewer than Two Drowning Prevention Safety Features
□ Pool - Fences / Gates / Barriers: Exterior House Door(s) Open Towards Pool Area
☐ Roof - Coverings: Roof Tile(s) Cracked, Broken, Loose and/or Missing
□ Roof - General: Roof Partially or Fully Obscured By
□ Roof - General: Roof Inspection Limited
☐ Roof - Skylights, Chimneys & Other Roof Penetrations: Skylight: Glazing Cracked, Damaged and/or Missing
☐ Electrical - Excluded Items: Cable / Satellite / Telephone / Inter Communication / Alarm Stystems
☐ Electrical - Excluded Items: Photovoltaic Solar Energy System
□ Electrical - Panels: Screws Pointed

Electrical - Smoke Detectors / CO Alarms / Door Bell: Smoke Alarm Over 10 Years Old
Electrical - Smoke Detectors / CO Alarms / Door Bell: Carbon Monoxide Alarm "Plug-in" Type
Electrical - Panel Wiring & Breakers: Open Knockouts
Electrical - GFCI / AFCI Protection: Missing GFCI Protection
Electrical - Switches / Receptacles: Dryer 3 Slot Receptacle
Electrical - Switches / Receptacles: Exterior Rated Cover Plate Damaged / Missing
Electrical - Lighting & Fans: Lamps Inoperable
HVAC - Air Conditioner: Not Secured to Pad
HVAC - Air Conditioner: A/C Noisy During Operation
HVAC - Air Conditioner: Lifespan (10-15 years)
HVAC - Air Conditioner: Refrigerant Line Insulation Deteriorated / Missing
HVAC - Heating / Forced Air: Lifespan (15-20 yrs)
HVAC - General comments : Service Heating / Cooling System
Interior, Doors, Windows - Exterior Doors: Exterior Door Won't Latch
Interior, Doors, Windows - Exterior Doors: Exterior Door Opens Outward
Interior, Doors, Windows - Stairs: Guardrail Gaps Wider Than 4"
Interior, Doors, Windows - Ceiling: Water Stains (Dry)
Interior, Doors, Windows - Windows: Screens Damaged
Interior, Doors, Windows - Windows: Sash-side Springs Broken / Loose
Interior, Doors, Windows - Windows: Difficult to Open,Close
Interior, Doors, Windows - Windows: Screens Missing
Interior, Doors, Windows - Countertops & Cabinets: Obscured by stored items
Interior, Doors, Windows - Floors: Tile / Grout Loose / Cracked / Damaged / Deteriorated
Interior, Doors, Windows - Interior Doors: Closet Door Off Track

1: GENERAL INFORMATION / OVERVIEW

Information

General: Overview

A home inspection is a non invasive, visual examination of the accessible areas of the property, designed to identify areas of concern within specific systems or components defined by the InterNACHI Standards of Practice, that are both observed and deemed material by the inspector at the exact date and time of inspection. Any and all recommendations for repair, replacement, evaluation, and maintenance issues found, should be evaluated by the appropriate trades contractors within the clients inspection contingency window or prior to closing, which is contract applicable, in order to obtain proper dollar amount estimates on the cost of said repairs and also because these evaluations could uncover more potential issues than able to be noted from a purely visual inspection of the property. This inspection will not reveal every concern or issue that exists, but only those material defects that were observable on the day of the inspection. This inspection is intended to assist in evaluation of the overall condition of the dwelling only. This inspection is not a prediction of future conditions and conditions with the property are subject to change the moment we leave the premises.

General: Notes

Note: California has seasonable rains which occur at the end and the beginning of each calendar year. Occasionally, the rainfall is exceptionally high. This is called an El Nino year. In recent years Southern California has been going through a drought. During drought periods many conditions visible following rains do not appear. The duty of a home inspector is to disclose visible conditions. If a condition is not visible it cannot be reported.

Note: Read the Standards of Practice set forth by the InterNational Association of Certified Home Inspectors for an insight into the scope of the inspection.

Note: The inspection represents the condition of the visually inspected areas of the property on the date of the inspection. Component conditions may change between the date of the inspection and the title transfer date. A thorough walk-through prior to title transfer helps protect against unexpected surprises, and is recommended. **The purchase of a home warranty is recommended. You can purchase an 18 month warranty for the cost of a 12 month warranty by clicking here.**

Notice to Third Parties: This report is the exclusive property of Cal-Pro Real Estate Inspections and the Client(s) listed above and is not transferable to any third parties or subsequent buyers. Our Inspection and this report have been performed with a written contract agreement that limits its scope and usefulness. Unauthorized recipients are therefore advised not to rely upon this report, but rather to retain the services of an appropriately qualified property inspector of their choice to provide them with their own inspection and report.

Note: For the purpose of this report, all directional references (left, right, rear, front) are based on when facing the front of the structure as depicted in the cover image above.

General: About Thermal Imaging

Note: A Thermal Imaging camera may be used as a means of evaluating certain suspect issues or systems. Any anomalies found are always verified by other means such as a moisture meter. Moisture must be present for infrared thermography to locate its existence. During dry times a leak may still be present but undetectable if materials have no moisture present. **Thermal Imaging is not X-ray vision, cannot see through walls and cannot detect mold.**

General: Comment Key and Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any findings / comments that are listed under "Safety / Major" by the inspector suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = The item, component or system was visually inspected and if no other comments were made, then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = The item, component or system was not inspected and no representations made of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = The item, component or system is not in this home or building.

Finding (F) = The item, component or system was inspected and a concern, observation and/or deficiency was found and falls under one of the categories below.

Note = The item or discovery indicated is considered cosmetic, nuisance or is "For Your Information". The items, although should be repaired, are not considered to be in need of immediate repair. Any items or recommendations in this category should not be considered as an enforceable repair or responsibility of the sellers, but designed only to provide you with specific information about the property.

Minor = The item, component, or system while perhaps functioning as intended is in need o**fninor** repair, service, or maintenance; is showing signs of wear or deterioration that could result in an adverse condition at some point in the future; or considerations should be made in upgrading the item, component, or system to enhance the function, efficiency and / or safety. Items falling into this category can frequently be addressed by a **homeowner or handyman** and are considered to be routine homeowner maintenance (DIY) or recommended upgrades.

Moderate = The item, component, or system while perhaps functioning as intended is in need of **moderate** repair, service; is showing signs of wear or deterioration that could result in an adverse condition at some point in the future; or considerations should be made in upgrading the item, component, or system to enhance the function, efficiency and / or safety. Items falling into this category can frequently be addressed by a **handyman or a qualified contractor** and are not considered routine maintenance or DIY items.

Safety / Major = The item, component or system poses a safety concern to occupants in or around the home. Some listed concerns will be considered acceptable for the time period of construction but pose a current risk.

The item, component or system is**Not** functioning as intended, or needs further evaluation by a specialized qualified licensed contractor or can cause damage to the structure. Items, components or units that can be repaired to satisfactory condition may not need replacement.

2: INSPECTION / PROPERTY DETAILS

Information

General: In Attendance

Buyers Agent

General: Utilities

All Utilities On

General: Weather Conditions

Dry, Sunny

General: Building Type

Single Family

General: Building faces

North East

General: Occupancy

Occupied, Furnished

General: Temperature

50-60 F

3: MISC. CONCERNS / COMMENTS

Information

Misc. Concerns / Comments: Occupied and/or Furnished

Note: Many areas and items at this property were obscured by furniture stored items. This often includes but is not limited to walls, floors, windows, inside and under cabinets, under sinks, on counter tops, in closets, behind window coverings, under rugs or carpets, and under or behind furniture. Areas around the exterior, under the structure, in the garage and in the attic may also be obscured by stored items. The inspector in general does not move personal belongings, furnishings, carpets or appliances. When furnishings, stored items or debris are present, all areas or items that are obscured, concealed or not readily accessible are excluded from the inspection. The client should be aware that when furnishings, stored items or debris are eventually moved, damage or problems that were not noted during the inspection may be found.

Findings

3.1.1 Misc. Concerns / Comments



RODENT EVIDENCE

ATTIC (FECES & AMP; HOLES IN INSULATION)

Evidence of rodent infestation was found in the form of feces, urine stains, traps, poison, dead rodents and/or damaged insulation. Consult with the property owner about this. A qualified person should make repairs to seal openings in the structure, set traps, and clean rodent waste as necessary. Future costs could be incurred from prior rodent damage not visible at time of inspection.

Recommendation

Contact a qualified pest control specialist.

3.1.2 Misc. Concerns / Comments

Moderate

MICROBIAL LIKE GROWTHS

GARAGE STORAGE ROOM

Microbial like growths were found at one or more locations. It is beyond the scope of this inspection to identify what substance or organism this staining is. However such staining is normally caused by excessively moist conditions, which in turn can be caused by plumbing or building envelope leaks and/or substandard ventilation. These conducive conditions should be corrected before making any attempts to remove or correct the staining. Normally affected materials such as drywall are removed, enclosed affected spaces are allowed to dry thoroughly, a mildewcide may be applied, and only then is drywall reinstalled. For evaluation and possible mitigation, consult with a qualified industrial hygienist or mold/moisture mitigation specialist.

Recommendation

Contact a qualified mold inspection professional.





4: GROUNDS

		IN	NI	NP	F
4.1	Grading	Χ			Χ
4.2	Vegetation	Χ			Χ
4.3	Driveways, Sidewalks, Patios	Χ			Χ
4.4	Fences/Gates	Χ			Χ

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

Grading: Site Profile

Level

Driveways, Sidewalks, Patios: Driveway

Concrete

Driveways, Sidewalks, Patios:

Sidewalk & Patios

Concrete

Fences/Gates: Fence / Gate Type

Wood, Metal

Findings

4.1.1 Grading



SOIL IN CONTACT WITH STUCCO, BRICK AND/OR STONE (FAULTY GRADING)

LEFT REAR SIDE, RIGHT SIDE, LEFT FRONT


Soil was in contact with or less than 6 inches from stucco, brick, stone or faux stone veneer. Condensed water behind the veneer may not be able to escape, and moisture can accumulate in the wood structure behind. This also presents a pathway for wood destroying organisms to enter the dwelling undetected. Recommend grading and/or removing soil as necessary to maintain a 6-inch clearance.

Recommendation

Contact a handyman or DIY project





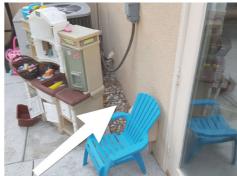

Left Front Left Rear Side

Right Side

4.2.1 Vegetation

VEGETATION TOO CLOSE / IN CONTACT WITH BUILDING





Vegetation such as trees, shrubs and/or vines was in contact with or close to the building exterior and/or other structures. Vegetation can serve as a pathway for wood-destroying insects and can retain moisture against the exterior after it rains. This is a conducive condition for wood-destroying organisms. Recommend pruning, moving or removing vegetation as necessary to maintain at least 6 inches of space between it and the building exterior. A 1-foot clearance is better.



Recommendation

Contact a qualified lawn care professional.

4.3.1 Driveways, Sidewalks, Patios

Safety / Major

SIDEWALK / PATIO CRACKS / DETERIORATION - TRIP HAZARD - REPAIR

FRONT

Cracks, holes, settlement, heaving and/or deterioration resulting in trip hazards were found in the sidewalks or patios. For safety reasons, recommend that a qualified contractor repair as necessary to eliminate trip hazards.

Recommendation

Contact a qualified concrete contractor.



4.4.1 Fences/Gates

FENCE REPAIR - MINOR

VARIOUS

Fences and/or gates are damaged and/or deteriorated in some areas. Make repairs or replace sections as necessary.

Recommendation

Contact a handyman or DIY project



5: EXTERIOR

		IN	NI	NP	F
5.1	Exterior Walls/Trim	Χ			
5.2	Eaves / Soffits	Χ			

IN = Inspected NI = N

NI = Not Inspected

NP = Not Present

F = Findings

Information

Exterior Walls/Trim: Building Construction Material Type

Wood Frame

Exterior Walls/Trim: Wall Covering Material Type

Stucco

Eaves / Soffits: Type

Enclosed

6: ROOF

		IN	NI	NP	F
6.1	General	Χ			Χ
6.2	Coverings	Χ			Χ
6.3	Flashings	Χ			
6.4	Skylights, Chimneys & Other Roof Penetrations	Χ			Χ
6.5	Roof Drainage Systems	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

General: Inspection Method

From eaves using ladder, From

windows

Metal

Flashings: Material

General: Roof Type/Style Hip

Tile, Rolled

Roof Drainage Systems: Gutter Material

Metal

Roof Drainage Systems:

Coverings: Material

Installation **Partial**

Findings

6.1.1 General

ROOF PARTIALLY OR FULLY OBSCURED BY

Solar Panels

The roof could not be fully evaluated.



Minor

6.1.2 General

ROOF INSPECTION LIMITED

Normally the inspector attempts to traverse roof surfaces during the inspection. However, due to type of roof covering (slippery or fragile), roof configuration (steep or very high) and/or slippery conditions, the inspector was unable to traverse the roof and wasn't able to fully evaluate the entire roof surface.

Recommendation

Contact a qualified roofing professional.

6.2.1 Coverings

ROOF TILE(S) CRACKED, BROKEN, LOOSE AND/OR MISSING



Roof tiles were cracked, broken, missing and/or loose. Leaks may occur as a result. This is a conducive condition for wood-destroying organisms. Recommend that a qualified person replace tiles or make repairs as necessary.

Recommendation

Contact a qualified roofing professional.







Front (broken / loose)

Front (cracked)

Front (loose)

6.4.1 Skylights, Chimneys & Other Roof Penetrations



SKYLIGHT: GLAZING CRACKED, DAMAGED AND/OR MISSING

REAR PATIO COVER

Glass in one or more skylights was cracked, broken and/or missing. Recommend that a qualified contractor replace glass as necessary.

Recommendation

Contact a qualified roofing professional.



7: GARAGE / CARPORT

		IN	NI	NP	F
7.1	Structure	Χ			
7.2	Occupant Doors	Χ			Х
7.3	Vehicle Door	Χ			
7.4	Automatic Opener	Χ			
7.5	Floor, Walls, Ceiling	Χ			Χ

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

Structure: TypeAttached Garage

Automatic Opener: Safety Devices

Pressure sensitive, Electronic eye, Reversed when tested

Occupant Doors: Type

w/ visible fire rating, Foam core

Floor, Walls, Ceiling: Wall Type
Finished

Vehicle Door: Type

Sectional, Metal

Floor, Walls, Ceiling: Ceiling Type

Finished

Findings

7.2.1 Occupant Doors

DOOR NOT FIRE RESISTANT



The door between the garage and the house did not appear to be fire resistant, or the inspector was unable to verify that it was via a label. This is a potential safety hazard. House to garage doors, to prevent fire and fumes from spreading from the garage into interior living space, should be constructed of fire-resistant materials. Doors, generally considered to be suitable for the purpose, are solid core wood (at least 1 3/8 inches thick), steel, honeycomb steel or a door that has been factory labeled as fire rated. Recommend that a qualified contractor replace or repair the door and, at that time, make any other corrections that might be required to provide suitable fire resistance between the garage and the dwelling per standard building practices.

Note: The fire rating label that is attached to the door appears suspicious.

Recommendation

Contact a qualified door repair/installation contractor.

7.5.1 Floor, Walls, Ceiling

UNPROTECTED FURNACE

Appliances such as the water heater and/or furnace were subject to damage from vehicles because no protective barrier was installed in front of them. This is a potential safety hazard for fire and/or shock. A qualified contractor should install a barrier per standard building practices. For example, a steel post or specially made wood partition anchored in the concrete slab floor.

Recommendation

Contact a qualified professional.





8: INTERIOR, DOORS, WINDOWS

		IN	NI	NP	F
8.1	Exterior Doors	Χ			Χ
8.2	Interior Doors	Χ			Χ
8.3	Windows	Χ			Χ
8.4	Walls	Χ			
8.5	Ceiling	Χ			Χ
8.6	Floors	Χ			Χ
8.7	Countertops & Cabinets	Χ			Χ
8.8	Stairs	Χ			Χ

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

Exterior Doors: Exterior doors

Wood, Glass panel

Ceiling: Ceiling type

Drywall

Windows: Window type

Single-hung, Vinyl, Multi-pane,

Sliding

Floors: Floor type

Carpet, Tile, Wood, Vinyl /

linoleum

Walls: Wall types


Drywall

Findings

8.1.1 Exterior Doors

EXTERIOR DOOR OPENS OUTWARD

REAR, RIGHT SIDE

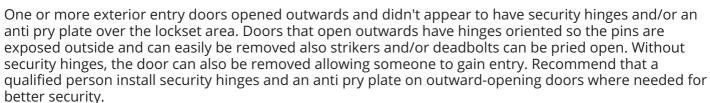

Recommendation

Contact a qualified door repair/installation contractor.







8.1.2 Exterior Doors

EXTERIOR DOOR WON'T LATCH



FRONT ENTRY DOOR

One or more doors wouldn't latch or were difficult to latch. Recommend that a qualified person repair as necessary. For example, by adjusting latch plates or locksets.

Recommendation

Contact a qualified handyman.

8.2.1 Interior Doors

CLOSET DOOR OFF TRACK



2ND FLOOR RIGHT SIDE BEDROOMS

The closet doors in one or more locations were off track. Recommend repair for proper functionality.

Recommendation

Contact a qualified handyman.

8.3.1 Windows

DIFFICULT TO OPEN, CLOSE



MASTER BEDROOM

One or more windows were difficult to open and close. Recommend repair by window contractor.

Recommendation

Contact a qualified window repair/installation contractor.

8.3.2 Windows

SASH-SIDE SPRINGS BROKEN / LOOSE



MASTER BEDROOM

The sash-side spring mechanisms in one or more windows were broken, loose or disconnected. The window(s) were difficult to operate as a result, and not square in their frames or tracks. Recommend that a qualified contractor or service technician repair as necessary so windows open and close easily, and stay open without support.

Recommendation

Contact a qualified window repair/installation contractor.

8.3.3 Windows

Minor

SCREENS DAMAGED

FAMILY ROOM, LAUNDRY

One or more window screens were damaged or deteriorated. These window(s) may not provide ventilation during months when insects are active. Recommend replacing window screens as necessary.

Recommendation

Contact a qualified window repair/installation contractor.

8.3.4 Windows

SCREENS MISSING



FORMAL LIVING ROOM, KITCHEN

Screens were missing from one or more windows. These windows may not provide ventilation during months when insects are active. On second story windows, these are also deterrants to keep small children from falling out of open windows during cooler temperatures. Recommend installing screens.

Recommendation

Contact a qualified window repair/installation contractor.

8.5.1 Ceiling

WATER STAINS (DRY)



WATER HEATER CLOSET

Stains were found in one or more ceiling areas. However, no elevated levels of moisture were found. The stain(s) may be due to past roof and/or plumbing leaks. Consult with the property owner and monitor the stained area(s) in the future, especially after heavy or prolonged rain. If elevated moisture is found in the future, then recommend that a qualified contractor evaluate and repair as necessary. The inspector is limited to only being able to evaluate conditions at time of inspection and in a non-invasive manner.



Recommendation

Contact a qualified professional.

8.6.1 Floors



TILE / GROUT LOOSE / CRACKED / DAMAGED / DETERIORATED

LAUNDRY

Tile or grout in the flooring in one or more areas was loose, cracked, damaged and/or deteriorated. Recommend that a qualified contractor repair as necessary.

Recommendation

Contact a qualified flooring contractor



Laundry

8.7.1 Countertops & Cabinets

OBSCURED BY STORED ITEMS

MASTER BATHROOM, 2ND FLOOR HALLWAY BATHROOM

The countertops and/or areas below sink(s) were obscured by stored items and couldn't be fully evaluated.

8.8.1 Stairs







Minor

Guardrails at one or more locations with drop-offs higher than 30 inches had gaps that were too large. This poses a safety hazard for children (e.g. falling, getting stuck in railing). Although a common building practice in older homes, guardrails should not have gaps or voids that allow passage of a sphere equal to or greater than 4 inches in diameter, or 6 inches in diameter at triangular spaces between stair edges and guardrails. Recommend that a qualified contractor repair or replace guardrails per standard building practices.

Recommendation

Contact a qualified carpenter.





9: PLUMBING

		IN	NI	NP	F
9.1	Service	Χ			Χ
9.2	Supply Lines	Χ			Χ
9.3	Drain, Waste, & Vent Systems	Χ			Χ
9.4	Water Heater	Χ			Χ
9.5	Sinks / Fixtures	Χ			Χ
9.6	Toilets / Bidets	Χ			Χ
9.7	Bathtub / Shower	Χ			
9.8	Laundry	Χ			Χ
9.9	Exhaust Fans / Ventilation	Χ			
9.10	Irrigation	Χ			Χ
9.11	Fuel Storage & Distribution Systems	Χ			

IN = Inspected NI = Not Inspected NP

NP = Not Present F = Findings

Information

Service: Water Service Type

Public

Service: Sewer Type

Public

Drain, Waste, & Vent Systems:
Drain Line Materials Observed

PVC

Drain, Waste, & Vent Systems: Clean-out Location(s)

Exterior

Water Heater: Capacity 60 Gallons, 60 Gallons Service: Water Shut-Off Location Service: Water meter location

Exterior, Right side

Service: Pressure Regulator

Present

No

Drain, Waste, & Vent Systems: Waste Materials Observed

ABS Plastic Waste

Water Heater: Estimated Mfg.

Year 2005

Water Heater: Location

Garage, Closet

By street

Supply Lines: Materials

ObservedCopper

Drain, Waste, & Vent Systems:

Vent Materials Observed

ABS

Water Heater: Energy Source /

Type

Tank, Natural gas

Bathtub / Shower: Shower Pan

Flood Tested / Ok 1st Floor Bathroom

Tiled shower pan was flood tested and no leaks were detected at this time.



Laundry: Laundry Information

240 Volt Electric, Gas Supply, Washer Water Supply Hook-ups, Clothes Washer Present (not tested), Dryer Present (not tested)

Exhaust Fans / Ventilation: Type Irrigation: Irrgation Type Exhaust fan

Public

Fuel Storage & Distribution Systems: Main Gas Shut-off Location

Fuel Storage & Distribution Systems: Fuel Service Type

Natural Gas

Gas Meter, Exterior Left Side

Service: Water Pressure

70-80 PSI

View of water pressure at the time of the inspection. 50 to 80 PSI is acceptable 60 to 75 PSI is ideal.



Findings

9.1.1 Service

MAIN LEAKING

RIGHT SIDE

The main water shut-off valve was leaking. Recommend that a qualified plumber repair or replace the valve as necessary.

Recommendation

Contact a qualified plumbing contractor.



9.2.1 Supply Lines

HOSE BIB MISSING BACKFLOW PREVENTER

VARIOUS

One or more hose bibs were missing backflow prevention devices. These devices reduce the likelihood of gray water entering the potable water supply. Recommend installing backflow prevention devices on all hose bibs where missing. They are available at most home improvement stores and are easily installed.

Recommendation

Contact a handyman or DIY project



Safety / Major



9.2.2 Supply Lines

HOSE BIB LEAKED WHILE OFF



RFAR

One or more hose bibs (outside faucets) leaked while off. When hose bibs leak while turned off, it's often caused by a worn valve seat or a loose bonnet. Recommend that a qualified plumber repair as necessary.

Recommendation

Contact a qualified plumbing contractor.



Rear

9.2.3 Supply Lines

HOSE BIB LEAKED WHILE ON



One or more hose bibs (outside faucets) leaked while on. When hose bibs leak while turned on, it may be due to worn "packing" around the stem or a defective backflow prevention device. Recommend that a qualified plumber repair as necessary.

Recommendation

Contact a qualified plumbing contractor.

9.2.4 Supply Lines



EXTERIOR HOSE BIB NOT SECURE

REAR

One or more hose bibs weren't anchored securely to the structure's exterior. Water supply pipes can be stressed when hose bibs are turned on and off and when hoses are pulled. Leaks may occur as a result. Recommend that a qualified person install fasteners per standard building practices.

Recommendation

Contact a qualified plumbing contractor.



Rear

9.3.1 Drain, Waste, & Vent Systems

SEWERSCAN ISSUES



A SewerScan was requested of the main sewer drain line from the house to the city or private sewer connection. The following is a report of our findings. The recorded video will be provided here.

Belly: There is a low point in the drain line which can promote clogging. We recommend further review and repair as needed.

Location(s): 26.8 ft to 36.5 ft

Scale Buildup: There is scale build up inside the sewer line which can promote clogging. We recommend cleaning as needed.

Location(s): Various

Summary of findings: We recommend all repairs be evaluated and repaired by a qualified C42 licensed sewer contractor. It should be understood that sometimes due to extent of debris or roots found, we are unable to fully access the sewer line. We recommend further review of lines by a qualified plumbing contractor in these cases when cleared and the lines can be better accessed at that time.

SewerScan started from the clean-out located at the clean-out located at the left side of the garage to the city connection all measurments stated in the locations above are from the point of the SewerScan equipment in the photo below.

Recommendation

Contact a qualified plumbing contractor.







SewerScan started at the clean-out located at the left side of garage

Start of belly

Belly continued



Belly continued

9.4.1 Water Heater

LIFESPAN (8-12 YRS)



The estimated useful life for most water heaters is 8-12 years. This water heater appeared to be near, at or beyond this age and/or its useful lifespan and may need replacing at any time. Recommend budgeting for a replacement in the near future, or considering replacement now before any leaks occur. The client should be aware that significant flooding can occur if the water heater fails. If not replaced now, consider having a qualified person install a catch pan and drain or a water alarm to help prevent damage if water does leak.

Recommendation

Contact a qualified plumbing contractor.

9.4.2 Water Heater

Moderate

STAINS / DAMAGE BELOW / AROUND WATER HEATER

Water stains and/or damage were found below or near the water heater. This may be a sign that the water heater is failing, a sign of a past leak, or that the TPR valve is discharging. Consult with the property owner about this and review any disclosure statements. Depending on what information is available about the stains, a qualified plumber should evaluate and make repairs or replace the water heater as necessary.



Recommendation

Contact a qualified plumbing contractor.

9.5.1 Sinks / Fixtures



Safety / Major

DRAIN LINES / FITTINGS CORRODED

MASTER BATHROOM RIGHT SIDE SINK

Corrosion was found at drain lines and/or fittings under one or more sinks. This can indicate past leaks, or that leaks are likely to occur in the future. Recommend that a qualified plumber evaluate and repair as necessary.

Recommendation

Contact a qualified plumbing contractor.



Master Bathroom

9.5.2 Sinks / Fixtures

FLEXIBLE PIPE



Ribbed, flexible drain pipe was used at the sink. This type of drain pipe accumulates debris more easily than smooth wall pipe and is likely to clog. Recommend that a qualified plumber replace flexible piping with standard plumbing components (smooth wall pipe) to prevent clogged drains.

Recommendation

Contact a qualified plumbing contractor.



2nd Floor Hallway Bathroom

9.5.3 Sinks / Fixtures

DRAIN LEAK

KITCHEN (SMALL SINK)

One or more leaks were found at the sink drain. A qualified plumber should repair as necessary.



Recommendation

Contact a qualified plumbing contractor.



Kitchen (small sink)

9.5.4 Sinks / Fixtures

Moderate

WATER FILTER SERVICE SPOUT DAMAGED / INOPERABLE

KITCHEN

The water filter dispenser was damaged and/or inoperable. Recommend repairs by a qualified person.

Note: The filter system appears to have been removed.

Recommendation


Contact a qualified plumbing contractor.



9.6.1 Toilets / Bidets

TOILET LOOSE

2ND FLOOR HALLWAY BATHROOM

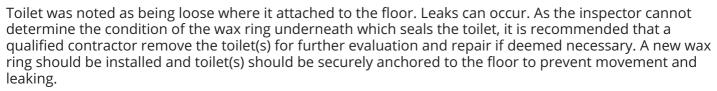

Recommendation

Contact a qualified plumbing contractor.

9.8.1 Laundry

Safety / Major

DRYER VENT NEEDS CLEANING - NOW

The clothes dryer exhaust duct appeared to terminate at the roof or routed upward. As a result significant amounts of lint can build-up and may reduce air flow over time. This can become a fire hazard if not properly maintained. Recommend that a qualified person clean this duct now and as necessary in the future. Some chimney sweeps or heating/cooling duct cleaners perform this service.

Click here for more information regarding dryer vents.

Note: There are two vents installed, the upper connection is the vent that should be clean if going to be used. The lower vent that extend to the exterior side wall does not appear to require cleaning at this time. Client should ask the current homeowner as to why a second vent was installed.



Clean upper vent if upper vent is going to be connected to the dryer



Recommendation

Contact a qualified professional.

9.10.1 Irrigation

SPRINKLERS HITTING STRUCTURE.



LEFT SIDE

Sprinklers appear to be hitting the structure. Recommend to redirect or change spray patterns of sprinkler heads.

Recommendation

Contact a qualified professional.



Minor

Left Side

9.10.2 Irrigation

SPRINKLER HEADS CLOGGED

LEFT FRONT, RIGHT REAR, LEFT REAR

One or more sprinkler heads appeared to be clogged. Recommend repairs by a qualified person.

Recommendation

Contact a qualified professional.







Left Rear Right Rear

10: ELECTRICAL

		IN	NI	NP	F
10.1	Excluded Items	Χ			Χ
10.2	Service	Χ			
10.3	Panels	Χ			Χ
10.4	Panel Wiring & Breakers	Χ			Χ
10.5	GFCI / AFCI Protection	Χ			Χ
10.6	Wiring	Χ			
10.7	Switches / Receptacles	Χ			Χ
10.8	Lighting & Fans	Χ			Χ
10.9	Smoke Detectors / CO Alarms / Door Bell	Χ			Χ

IN = Inspected NI = Not Inspected F = Findings NP = Not Present

Information

Service: Service Information

Underground, 120-240 Voltage, 1 phase 3 wire Voltage, System **Ground Unknown**

Panels: Main Panel Location

Exterior, Left side

Panels: Panel Capacity

200 AMP

Panels: Main disconnect rating

200 AMP

Panels: Sub Panel Location(s)

Pool equipment

Panel Wiring & Breakers: Over protection devices

Breakers

GFCI / AFCI Protection: GFCI

reset locations

Master bath, Garage, Kitchen, 1st floor bath, 2nd Floor Guest bath, Laundry

Wiring: Wiring Type

Non Metallic Sheathed, Copper, Aluminum Multi-Strand,

Aluminum Single Strand

Panels: Panel Equipment Photographs






GFCI / AFCI Protection: GFCI protection present

Yes

A **Ground Fault Circuit Interrupter** (GFCI) - Is an ultra sensitive receptacle outlet and/or breaker designed to shut off all electric current. Used in bathrooms, kitchens, exterior waterproof outlets, garage outlets, and "wet areas" to prevent electrical shock. Has a small reset / test button on the receptacle and/or breaker.

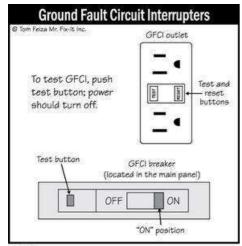


E078

GFCI / AFCI Protection: AFCI protection present

No

An **Arc Fault Circuit Interrupter** (AFCI) is a circuit breaker that breaks the circuit when it detects an electric arc in the circuit it protects to prevent electrical fires. An AFCI selectively distinguishes between a harmless arc (incidental to normal operation of switches, plugs, and brushed motors), and a potentially dangerous arc (that can occur, for example, in a lamp cord which has a broken conductor).

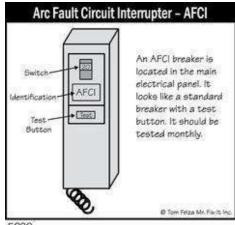

E020

Smoke Detectors / CO Alarms / Door Bell: Smoke Detector Installed / Location(s)

Yes, Bedrooms, 2nd Floor Hallway, 2nd Floor Hallway, Hardwired / Interconnected

Note: Smoke detectors are tested only for audibility and not tested using actual smoke.

Smoke Detectors / CO Alarms / Door Bell: Carbon Monoxide Alarm(s) Installed / Location(s)

Yes, 2nd Floor Hallway, 2nd Floor Hallway

Note: Carbon Monoxide alarms are tested only for audibility and not tested using actual Carbon Monoxide.

Findings

10.1.1 Excluded Items



CABLE / SATELLITE / TELEPHONE / INTER COMMUNICATION / ALARM STYSTEMS

Note: If present, cable, satellite, telephone, inter communication and alarm systems are not inspected. Evaluating these systems are beyond the scope of a property inspection. Their condition is unknown, and they are excluded from this inspection. Recommend that a qualified specialist review these systems and make repairs if necessary.

Recommendation

Contact a qualified professional.

10.1.2 Excluded Items

Moderate

PHOTOVOLTAIC SOLAR ENERGY SYSTEM

Note: A photovoltaic solar energy system was installed. Evaluating these systems is beyond the scope of a home inspection. Its condition is unknown, and it is excluded from this inspection. Recommend that a qualified electrician review this system and make repairs if necessary.

Recommendation

Contact a qualified professional.

10.3.1 Panels

SCREWS POINTED



MAIN PANEL

One or more pointed and/or too-long screws are used to fasten the cover to a service panel. These types of screws are more likely to come into contact with wiring inside the panel than stock screws from the manufacturer, and can damage wiring insulation. Long and/or pointed crews should be replaced as necessary with the correct screws.

Recommendation

Contact a qualified electrical contractor.

10.4.1 Panel Wiring & Breakers

Safety / Major

OPEN KNOCKOUTS

MAIN PANEL

One or more knockouts were missing. Holes in panels are a potential fire hazard if a malfunction ever occurs inside the panel. Rodents can also enter panels through holes. Recommend that a qualified person install knockout covers where missing and per standard building practices.

Recommendation

Contact a qualified electrical contractor.



Main Panel

10.5.1 GFCI / AFCI Protection

MISSING GFCI PROTECTION

EXTERIOR RIGHT SIDE, EXTERIOR LEFT SIDE



One or more locations at this property were noted as not having GFCI protection or the inspector was unable to verify if GFCI protection existed at these locations. Adoption of GFCI outlets was generally phased in over numerous years/decades. Recommend client evaluate upgrading these areas to GFCI protection at their discretion.

General guidelines for GFCI-protected receptacles include the following locations:

- 1. Outdoors (since 1973)
- 2. Bathrooms (since 1975)
- 3. Garages(since 1978)
- 4. Kitchens (since 1987)
- 5. Crawl spaces and unfinished basements (since 1990)
- 6. Wet bar sinks (since 1993)
- 7. Laundry and utility sinks (since 2005)

Recommendation

Contact a qualified electrical contractor.





Exterior Left Side

Exterior Right Side

10.7.1 Switches / Receptacles

DRYER 3 SLOT RECEPTACLE



A 3-slot receptacle was installed for the clothes dryer. Most modern clothes dryers use both 120 and 240 volts (120 for timers and motors, and 240 for heating elements) and either require or are more safely installed with a 4-slot receptacle. With 3-conductor wiring, the ground wire rather than a neutral wire is used to carry the return current back for the 120 volt leg. The clothes dryer's metal frame can become energized if the neutral wire becomes loose at the receptacle or panel. While 3-wire clothes dryer circuits were allowed prior to 1996 and are commonly found, they are considered unsafe due to the risk of shock. Recommend that a qualified electrician convert this to a 4-wire circuit. Note that this may require installing a new circuit wire from the panel to the clothes dryer location.

Recommendation

Contact a qualified electrical contractor.

10.7.2 Switches / Receptacles

A Safety / Major

EXTERIOR RATED COVER PLATE DAMAGED / MISSING

RIGHT SIDE, LEFT SIDE

One or more exterior receptacle covers were broken and/or missing. This is a potential shock hazard. Recommend that a qualified person replace covers where necessary.

Recommendation

Contact a qualified electrical contractor.






Left Side

Right Side

10.8.1 Lighting & Fans

LAMPS INOPERABLE

AREA ADJACENT TO THE FORMAL DINING ROOM

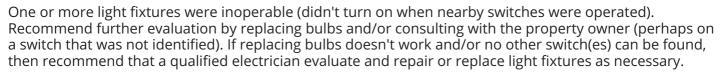

Recommendation

Contact a qualified electrical contractor.

10.9.1 Smoke Detectors / CO Alarms / Door Bell

SMOKE ALARM OVER 10 YEARS OLD

NUMEROUS



Based on the age of this structure and the appearance of existing smoke alarms, the alarms may have been installed more than 10 years ago. According to the National Fire Protection Association, aging smoke alarms don't operate as efficiently and often are the source for nuisance alarms. Older smoke alarms are estimated to have a 30% probability of failure within the first 10 years. Newer smoke alarms do better, but should be replaced after 10 years. Unless you know that the smoke alarms are new, replacing them when moving into a new residence is also recommended by NFPA. We recommend installing photoelectric type smoke detectors / alarms.

Recommendation

Contact a handyman or DIY project

10.9.2 Smoke Detectors / CO Alarms / Door Bell

CARBON MONOXIDE ALARM "PLUG-IN" TYPE

2ND FLOOR HALLWAY, LAUNDRY



Recommendation

Contact a handyman or DIY project



11: BUILT-IN APPLIANCES

		IN	NI	NP	F
11.1	Microwave	Χ			
11.2	Range/Oven/Cooktop	Χ			Χ
11.3	Exhaust / Ventilation	Χ			
11.4	Dishwasher	Χ			Χ
11.5	Garbage / Food Disposal	Χ			
11.6	Refrigerator	Χ			
11.7	Trash Compactor			Х	
11.8	Point-of-Use Hot Water Dispenser			Х	
11.9	Central Vacuum	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

Microwave: Type

Built-in

Range/Oven/Cooktop: Energy Source / Supply

Natural Gas, Electronic Ignition,

Range/Oven/Cooktop: Type

Separate Oven, Separate

Cooktop

Refrigerator: Water supply

connection

Yes

Electric (220v)

Exhaust / Ventilation: Type

Openable Window, Downdraft,

Vented / Ducted

Range/Oven/Cooktop: Oven Self

Cleaning

Yes

Refrigerator: Stays?

Yes

Findings

11.2.1 Range/Oven/Cooktop

COOKTOP / STOVE BURNER IGNITOR(S) DO NOT SHUT OFF



The ignitor did not shut off after lighting one or more cooktop burners. Recommend a qualified appliance repair person evaluate and repair as necessary.

Recommendation

Contact a qualified appliance repair professional.

11.4.1 Dishwasher



NOT SECURE, MISSING / DAMAGED SCREW(S) AND/OR BRACKET(S)

The dishwasher wasn't securely attached to the counter or cabinets (missing or damaged fasteners). Dishwasher movement is possible due to vibrations. Recommend that a qualified person install fasteners per standard building practices.

Recommendation
Contact a handyman or DIY project



Loose

12: HVAC

		IN	NI	NP	F
12.1	General comments	Χ			Χ
12.2	Heating / Forced Air	Χ			Χ
12.3	Heating / Individual / Not Forced Air			Χ	
12.4	Air Conditioner	Χ			Χ
12.5	Ducts and Registers	Χ			
12.6	Filter & Thermostat	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

Heating / Forced Air: Manufacturer

York, Carrier

Heating / Forced Air: Energy source

Natural gas

Air Conditioner: Location

Exterior

Heating / Forced Air: Estimated Year Mfg.

2006, 1992

Air Conditioner: Manufacturer

Carrier, Fraser-Johnston, Fraser-Johnston

Air Conditioner: System Type

Split system

Heating / Forced Air: Location

Garage

Air Conditioner: Estimated Year

Mfg.

1992, 2007

Air Conditioner: Temperature

split

20 F*, 18 F*

Ducts and Registers: Type

Ducts and Registers, Flex / insulated, Rigid / insulated

Filter & Thermostat: Filter Location(s)


Hallway, 2nd Floor


Filter & Thermostat: T-stat Location(s)

Hallway, 2nd Floor Hallway

Heating / Forced Air: Appears Functional

Heat system appears to be in working order. Supply air from the heating system should be 100 degrees Fahrenheit or higher. The photo(s) below is/are a thermal image of the supply air temperature at register(s) at the time of this inspection.

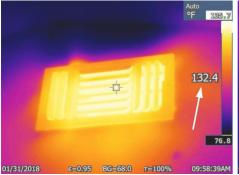

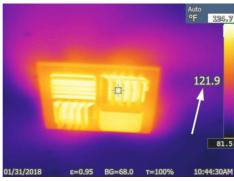


Second floor

First floor


Air Conditioner: Appears Functional

The temperature split differential between the return and registers was within the 14-22 degree (F) range at time of inspection.

The photo(s) below is/are a thermal image of the supply air temperature at supply and return air register(s) at the time of this inspection.

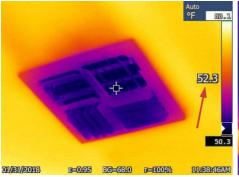



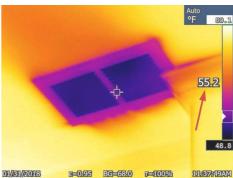

First floor supply air

Second floor return air

First floor return air

Second floor supply air

Findings

01/31/2018

12.1.1 General comments

SERVICE HEATING / COOLING SYSTEM



The last service date of the forced air heating / cooling system appeared to be more than 1 year ago, or the inspector was unable to determine the last service date. Ask the property owner when it was last serviced. If unable to determine the last service date, or if this system was serviced more than 1 year ago, recommend that a qualified HVAC contractor service this system and make repairs if necessary. Because this system has a compressor and refrigerant system, this servicing should be performed annually in the future. Any needed repairs noted in this report should be brought to the attention of the contractor when it's serviced.

Recommendation

Contact a qualified HVAC professional.

12.2.1 Heating / Forced Air



LIFESPAN (15-20 YRS)

The estimated useful life for most forced air furnaces is 15-20 years. This furnace appeared to be near, at or beyond this age and/or its useful lifespan and may need replacing or significant repairs at any time. Recommend budgeting for a replacement in the near future.

Recommendation

Recommend monitoring.



12.4.1 Air Conditioner

Moderate

LIFESPAN (10-15 YEARS)

The estimated useful life for most heat pumps and air conditioning condensing units is 10-15 years. This unit appeared to be near, at or beyond this age and/or its useful lifespan and may need replacing or significant repairs at any time. Recommend budgeting for a replacement in the near future.

Recommendation

Recommend monitoring.



12.4.2 Air Conditioner

A/C NOISY DURING OPERATION



The air conditioner was noisy during operation. Recommend further evaluation and needed repairs be made by a qualified licensed HVAC contractor.

Recommendation

Contact a qualified HVAC professional.



12.4.3 Air Conditioner

NOT SECURED TO PAD



The outside condenser unit was not secured to the concrete pad. Building standards require units to be secured to the pad to prevent damage, theft, and injury. Recommend a qualified person secure to the pad properly.

Recommendation

Contact a qualified HVAC professional.



12.4.4 Air Conditioner

Minor

REFRIGERANT LINE INSULATION DETERIORATED / MISSING

EXTERIOR RIGHT SIDE

Insulation on the air conditioning refrigerant lines was deteriorated or missing in some areas. This may result in reduced efficiency and increased energy costs. In attics it can cause sweating. Recommend that a qualified person replace or install insulation as necessary.

Recommendation

Contact a handyman or DIY project



Exterior Right Side

13: FIREPLACES AND FUEL-BURNING APPLIANCES

		IN	NI	NP	F
13.1	Fireplaces, Stoves & Inserts	Χ			Χ
13.2	Chimney(s)	Χ			Χ
13.3	Fuel Burning Appliance Flue(s)	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

Fireplaces, Stoves & Inserts:

Туре

Metal pre fab, Gas log, Wood burning converted to gas

Fuel Burning Appliance Flue(s):

Type

Metal, Type B

Fireplaces, Stoves & Inserts: Gas Chimney(s): Type log lighter

Metal

Yes

Findings

13.1.1 Fireplaces, Stoves & Inserts

GAPS FACE/FIREBOX

FAMILY ROOM

One or more gaps were found between the fireplace face and the firebox. Heat from the firebox may penetrate these gaps to combustible materials in the wall structure. This is a potential fire hazard. Recommend that a qualified contractor repair as necessar

Recommendation

Contact a qualified fireplace contractor.





Family Room

13.2.1 Chimney(s)

CHIMNEY SWEEP / CLEANING NEEDED

FAMILY ROOM

A significant amount of creosote or burning by-products (ash, soot, etc.) was visible in one or more chimneys. This is a potential fire hazard and a sign that chimney system maintenance has been deferred. The client should be aware that the type and quality of wood burned, and the moisture content of the wood, will affect the rate at which burning by-products accumulate in the chimney. When wood-burning devices are used regularly, they should be cleaned annually at a minimum. A qualified contractor should evaluate, clean, and repair if necessary.

Click here for more information regarding chimney cleaning.

Recommendation

Contact a qualified chimney sweep.



14: FOUNDATION

		IN	NI	NP	F
14.1	Foundation	Χ			
14.2	Seismic Re-Inforcement	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

Foundation: Foundation Type

Concrete Slab on Grade

Foundation: Foundation / Stem Foundation: Footing Material

Wall Material

Concrete, Slab on grade

Concrete slab

Seismic Re-Inforcement: Anchor **Bolts / Hold Downs**

Not visible, Unknown

15: ATTIC, INSULATION & VENTILATION

		IN	NI	NP	F
15.1	Access	Χ			
15.2	Structure & Sheathing	Χ			
15.3	Attic Insulation	Χ			
15.4	Exhaust & Ventilation	Χ			

IN = Inspected NI = Not Inspected NP = Not Present F = Findings

Information

Access: How Viewed Viewed From Hatches

Attic Insulation: Estimated R **Value** ~R-38

Access: Access Location(s) Master Bedroom Closet

Attic Insulation: Insulation Type Exhaust & Ventilation: Fiberglass Loose Fill, Fiberglass Roll

Structure & Sheathing: Structure & Sheathing Types

Trusses, Plywood Sheathing

Ventilation Type Soffit Vents, Gable Vents, **Bathroom Vents**

Access: Attic Views





16: POOL

		IN	NI	NP	F
16.1	General	Χ			
16.2	Body, Deck, Copings	Χ			
16.3	Fences / Gates / Barriers	Χ			Χ
16.4	Pumps, Filter, Skimmer	Χ			
16.5	Electrical	Χ			
16.6	Heater	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

F = Findings

Information

General: General Pool Condition Body, Deck, Copings: Pool

Clear Water

Material Types

Below Ground Pool, Tile Coping,

Concrete Deck

Fences / Gates / Barriers: **Fencing Material**

None installed

Type

Cartridge Filter

Pumps, Filter, Skimmer: Filter

Yes

Electrical: Electric Information Electrical: GFCI Protection

Disconnect at Subpanel By

Equipment


Heater: Heater Type

Natural Gas

General: View of Pool / Spa / Water Feature

Electrical: Pool Light

Yes, Operable

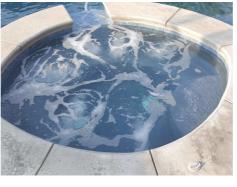



Fences / Gates / Barriers: **Drowning Prevention Safety**

Features Present

Alarms on Doors

Pumps, Filter, Skimmer: Pump

type

Multi speed, Single Speed,

Multiple pumps, Multiple pumps

Electrical: Pool Equipment

Bonded Yes

General: Equipment Photo(s)







Findings

16.3.1 Fences / Gates / Barriers



FEWER THAN TWO DROWNING PREVENTION SAFETY FEATURES

Effective January 1, 2018 the California Business and Professions Code Section 7195 require home inspectors to state the following in their reports when there are fewer than Two drowning prevention safety features:

CALIFORNIA HEALTH AND SAFETY CODE SECTION 115920-115929 now recommends a pool be equipped with at least Two of the following seven drowning prevention safety features:

- (1) The pool shall be isolated from access to a home by an enclosure that meets the requirements of Section 115923.
- (2) The pool shall incorporate removable mesh pool fencing that meets American Society for Testing and Materials (ASTM) Specifications F 2286 standards (the inspector is not able to determine if the ASTM specifications are met)
- (3) The pool shall be equipped with an approved safety pool cover.
- (4) The residence shall be equipped with exit alarms on those doors providing direct access to the pool.
- (5) All doors providing direct access from the home to the swimming pool shall be equipped with a self-closing, self-latching device with a release mechanism placed no lower than 54 inches above the floor.
- (6) Swimming pool alarms that, when placed in pools, will sound upon detection of accidental or unauthorized entrance into the water.
- (7) Other means of protection, if the degree of protection afforded is equal to or greater than that afforded by any of the devices set forth above.

Recommend installing two or more of the choices above. A qualified person should evaluate and repair or replace as necessary, and as per standard building practices.

Recommendation

Contact a qualified professional.

16.3.2 Fences / Gates / Barriers

ALARMS ON DOORS INOPERABLE

FORMAL DINING AREA, FAMILY ROOM, GARAGE STORAGE ROOM



The alarm for one or more doors between the house and the pool and/or spa was inoperable. All doors which give access to a swimming pool should be equipped with an audible alarm. A qualified person should evaluate and repair as necessary.

Recommendation

Contact a qualified professional.





Family Room

Formal Dining Area

16.3.3 Fences / Gates / Barriers

EXTERIOR HOUSE DOOR(S) OPEN TOWARDS POOL AREA



FAMILY ROOM, FORMAL DINING ROOM

One or more exterior house doors open out towards the pool or spa rather than inward. Standard building practices require that doors that have direct access to the pool / spa area open inward, away from the pool or spa. A qualified person should evaluate and repair as necessary, and as per standard building practices.

Recommendation

Contact a qualified door repair/installation contractor.